

# ACE

**Advanced Composition Explorer** 

# **ULEIS**

# Specific Instrument Interface Specification (SIIS)



The Johns Hopkins University
Applied Physics Laboratory
Johns Hopkins Road, Laurel, Maryland 20723

			REVISIONS		·
	REV.	BY & DATE	DESCRIPTION	CHECK	APPROVED & DATE
JC	А	11/1/95	Pins 1,2,3,5: A1020-J5 DATA CONNECTOR		
	:				

|--|

7345-9	012A

											. <del></del>
	;a	Т									
		<del>  </del>									
	7 7						-				
					OTY /	USED ON	├─	EFFECTIVITY	END ITEM SER. NO		WEIGHT
PART NU	MBER	SIZE	NEXT ASSEM	RLA	QTY./NA	USED ON					
DRAWN BY SECTION DATE			DATE				LIE	HE JOHNS HOPKII DPHYSICS OPKINS ROAD	NS UNIVERSITY  LABORAT  LAUREL, MD. 207		
CHECK	DATE		DATE			301	1113 111	J. KINO HOND			
GROUP	DATE		DATE					~** ******			
SYSTEM	DATE		DATE		ULEIS ADVANCED COMPOSITION EXPLORER						
PA ENGR	DATE		DATE	SPECIFIC INSTRUMENT INTERFACE SPECIFICATION							
	DATE		DATE								REV.
RELEASE:	,			FSCM	NO.	S	ZE	DWG. NO.			
RKL	K Butcher 11-8-95 88898 A 7345-9012				A						
										T	
ı				SCALE				DO NOT SCALE	PRINT	SHEET	11

# REVISION LOG

This log identifies the portions of this specification revised since the formal issue date.

REVISION

PAGE NUMBER

**REV DATE** 

APPROVAL

A

2-19-95

11-1-95

JA)

FSCM NO. 88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	iii

ENGINEERING C	HANGE	REQUEST
---------------	-------	---------

<u> 1345-9012</u> ULEIS SIIS J. CLOEREN 11/1/95 ORIGINATOR CHANGE IN A1020-J5 PIN-OUTS. PINS AFFECTED 1,2,3,5 WAS DATA DATA **PROCESSOR PROCESSOR** 26-pin high density 26-pin high density J5 (male) J5 (male) 311P407-2P-B-15 311P407-2P-B-15 P5 (female) P5 (female) 311P407-2S-B-15 311P407-2S-B-15 DATA CONNECTOR DATA CONNECTOR **CMD GATE-2** CMD GATE-1 CMD DATA-1 CMD CLOCK-1 2 CMD CLOCK-1 3 CMD DATA-1 3 4 **CHASSIS GROUND** CHASSIS GROUND 4 5 CMD GATE-1 CMD GATE-2 5 6 CMD CLOCK-2 CMD CLOCK-2 6 CMD DATA-2 7 CMD DATA-2 8 **CHASSIS GROUND** 8 **CHASSIS GROUND** 9 SIGNAL GROUND 9 SIGNAL GROUND 10 SIGNAL GROUND SIGNAL GROUND 10 11 11 MINOR FRAME-1 12 MINOR FRAME-1 12 13 TLM GATE-1 13 **TLM GATE-1** 14 TLM CLOCK-1 TLM CLOCK-1 14 15 TLM DATA-1 15 TLM DATA-1 **8X MAJOR FRAME-1** 16 16 **8X MAJOR FRAME-1** SUN PULSE-1 17 17 SUN PULSE-1 18 **SUN PULSE-2 SUN PULSE-2** 18 19 19 20 MINOR FRAME-2 MINOR FRAME-2 20 21 **TLM GATE-2** TLM GATE-2 21 22 TLM CLOCK-2 TLM CLOCK-2 22 23 TLM DATA-2 TLM DATA-2 23 8X MAJOR FRAME-2 24 24 **8X MAJOR FRAME-2** 25 SPIN CLOCK-1 SPIN CLOCK-1 25 SPIN CLOCK-2 SPIN CLOCK-2 26

REASON: TO CORRECT ERROR IN NSTRUMENT INFO. FFECTIVITY: ALL UNITS

REWORK OR NEW PART INFO: LINE OUT WORDS NOT APPLICABLE REWORK NOT PERMITTED REQUIRED. NEW SCRAP PART(S) NOT MADE OK.

# TECHNICAL CONTENT APPROVAL

JHU/APL		CAI	LTECH	
Prepared by J. M. Cloeren Spacecraft Instrument Interface	e Manager	Gerald Mur ACE Paylor	phy ad System Engine	eer
M. C. Chiu ACE Payload System Enginee	<del></del>			
U. I. von Mehlem Spacecraft System Engineer	llen~			
INSTRUMENT  Co- Investigator	<u> </u>	Payload Inst Interface En	Andrew- trument gineer	10/21/94
William Cross ACE System Manager	1/24/95			
John Thurber ACE Observatory Manager	4/26/25			
ត	FSCM NO.	SIZE DWG. NO.		
	88898	Α	7345-9012	
	SCALE	DO NOT SO	CALE PRINT	SHEET iV

# JHU/APL LEAD ENGINEERS TECHNICAL CONTENT REVIEW

R. F. Conde C&DH Subsystems	P. Panneton Power Subsystem
J. J. Maynard Thermal Engineer	J. P. Starger 10/17/94  J. P. Staiger I&T Engineer
C.E. Willey Structure	S. Schwartz EMC Engineer
T. Betenbaugh Stress Engineer	

88898	A	рwg, no. 7345-9012			
SCALE		DO NOT SCALE PRINT	SHEET	v	

1.0	General	1-1
1.1	Purpose Of Document	1-1
1.2	Overall Program	
1.3	Applicable Documentation	1-1
1.3.1	NASA Documents	
1.3.2	JHU/APL Documents	
1.3.3	Government Documents	
1.4	Document Configuration	
1.4.1	Update and Change Control	
1.5	Deliverables	
1.6	Instrument Operation And Handling Constraints And Hazards	1-5
2.0	Electrical Interface Requirements	2-1
2.1	General	2-1
2.1.1	C&DH Component Redundancy	2-1
2.2	System Grounding	2-4
2.2.1	General	2-4
2.2.1	Instrument/Sensor Grounding	2.4
	Single Point Ground (CDG)	2_1
2.2.2.1	Single Point Ground (SPG)	2.4
2.2.2.2	Chassis Ground	2.4
2.2.2.3	Primary D.C. Power Circuit Grounds	2 4
2.2.2.4	Secondary D.C. Power Circuit Grounds	2 <del>-4</del>
2.2.2.5	Signal Grounds	2-1
2.2.2.6	Shield Grounds	2-1
2.2.2.7	R.F. Bypassing	2-1
2.2.2.8	Variations In Grounding Configuration	2-1
2.2.2.9	Wiring	2-7
2.3	Power	2-7
2.3.1	Power Interface Characteristics	
2.3.1.1	Voltage	2-7
2.3.1.2	Power Allocation	2-9
2.3.1.3	Power Bus Source Impedance	2-9
2.3.1.4	Spacecraft Power Bus Normal Operation	2-9
2.3.1.5	Spacecraft Power Bus Abnormal Operation	2-9
2.3.2	Relay Considerations	2-11
2.3.2.1	Turn-On Transients	2-11
2.3.2.2	Turn-Off Transients	2-14
2.3.3	Power Wiring	2-14
2.3.4	Instrument/Sensor Power Profiles	2-14
2.4	Connectors	
2.4.1	General	2-14
2.4.1.1	Equipment Interface And Test Connector Selection	2-14
2.4.1.2	Magnetic Properties	2-14
2.4.2	Magnetic Properties	2-17
2.4.2.1	General	2-17
2.4.2.1	Pin Assignments	2-17
	Test And GSE Interface Connectors	
2.4.3	Flight Plugs And Locations	
2.4.4	Flight Flugs And Locations	<i>2-23</i> 2 72
2.4.4.1	Special Connector Plugs	∠-∠ <i>.</i> 2
2.4.5	rayload Stimulus And Monitor Interface	2-23

SCALE		DO NOT SCALE PRINT		vi
88898	Α	7345-9012		
FSCM NO.	SIZE	DWG. NO.		

2.5.1         C&DH Component Command Acceptance         2-28           2.5.2         Command Execution - Real-Time         2-28           2.5.4         C&DH Subsystem Command Interfaces         2-30           2.5.4.1         Logic Pulse Command         2-30           2.5.4.1.2         Interface         2-30           2.5.4.2.1         Data Command         2-30           2.5.4.2.1         Data Command (Switched Power)         2-34           2.5.4.3.1         Description         2-34           2.5.4.3.2         Interface         2-34           2.5.4.3.3         Interface         2-38           2.5.4.4.1         Description         2-34           2.5.4.3.2         Interface         2-38           2.5.4.4.1         Description         2-38           2.5.4.1.1         Pyrotechnic Grient Ground         2-38           2.5.4.1.1         Pyrotechnic Grient Ground         2-38           2.5.4.1.2         Firing Circuitry         2-38           2.5.4.1.1         Pyrotechnic Safety Short And Arm Plugs         2-38           2.5.4.1.2         Pyrotechnic Circuit Shields         2-42           2.6.1         Data Handling Component Interfaces         2-42           2.6.1.1	2.5	Spacecraft Command And Data Handling Subsystem	2-28
2.5.2         Command Execution - Stored         2-28           2.5.4         C&DH Subsystem Command Interfaces         2-30           2.5.4.1         Logic Pulse Command         2-30           2.5.4.1.1         Description         2-30           2.5.4.2.1         Interface         2-30           2.5.4.2.2         Data Command         2-30           2.5.4.2.3         Interface         2-34           2.5.4.3.1         Description         2-34           2.5.4.4.3.1         Pescription         2-38           2.5.4.4.1         Pyrotechnic Firing Voltage         2-38           2.5.4.4.1.1         Pyrotechnic Firing Voltage         2-38           2.5.4.4.1.2         Firing Circuitry         2-38           2.5.4.4.1.3         Pyrotechnic Gircuit Shields         2-42           2.5.4.5         Remote Relay Command         2-42           2.5.4.5         Remote Relay Command         2-42           2.6.1.1         Serial Digital Subsystem - Data Handling Portion </td <td>2.5.1</td> <td></td> <td></td>	2.5.1		
2.54.1         Coke DH Subsystem Command Interfaces         2.30           2.5.4.1.1         Logic Pulse Command         2.30           2.5.4.1.2         Interface         2.30           2.5.4.2.1         Data Command         2.30           2.5.4.2.2         Data Command         2.34           2.5.4.3.1         Interface         2.34           2.5.4.3.1         Description         2.34           2.5.4.3.1         Description         2.34           2.5.4.3.2         Interface         2.38           2.5.4.4.1         Interface         2.38           2.5.4.4.1         Pyrotechnic Firing Voltage         2.38           2.5.4.4.1.1         Pyrotechnic Firing Voltage         2.38           2.5.4.4.1.2         Pyrotechnic Firing Voltage         2.38           2.5.4.4.1.3         Pyrotechnic Safety Short And Arm Plugs         2.38           2.5.4.4.1.4         Pyrotechnic Circuit Shields         2.42           2.5.4.5         Remote Relay Command         2.42           2.6.1         Data Handling Component Interfaces         2.42           2.6.1.1         Description         2.42           2.6.1.2.1         Description         2.42           2.6.1.2.2         Interface	2.5.2		
2.5.4.1       Logic Pulse Command       2.30         2.5.4.1.2       Interface       2.30         2.5.4.2       Data Command       2.30         2.5.4.3       Relay Command (Switched Power)       2.34         2.5.4.3.1       Description       2.34         2.5.4.3.2       Interface       2.38         2.5.4.4.1       Pyrotechnic Firing Voltage       2.38         2.5.4.4.1.1       Pyrotechnic Firing Voltage       2.38         2.5.4.4.1.2       Firing Circuitry       2.38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2.38         2.5.4.4.1.3       Pyrotechnic Circuit Shields       2.42         2.5.4.5       Remote Relay Command       2.42         2.6.1       Data Handling Component Interfaces       2.42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2.42         2.6.1.2.1       Description       2.42         2.6.1.2.1       Description       2.50         2.6.1.3.1       Description       2.50         2.6.1.3.2       Interface       2.50         2.6.1.3.1       Description       2.50         2.6.1.4.2       Interface       2.50         2.6.1.4.1       De	2.5.3	Command Execution - Stored	2-28
2.5.4.1.1       Description       2-30         2.5.4.2       Data Command       2-30         2.5.4.2.1       Interface       2-34         2.5.4.3.1       Description       2-34         2.5.4.3.2       Interface       2-38         2.5.4.3.3       Interface       2-38         2.5.4.4       Relay Command (Ordnance)       2-38         2.5.4.1       Interface       2-38         2.5.4.1.1       Pyrotechnic Firing Voltage       2-38         2.5.4.1.2       Firing Circuitry       2-38         2.5.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2-38         2.5.4.4.1.3       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Description       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Digital Telltale       2-50         2.6.1.2.2       Digital Telltale       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.5	2.5.4	C&DH Subsystem Command Interfaces	2-30
2.5.4.1.1       Description       2-30         2.5.4.2       Data Command       2-30         2.5.4.2.1       Interface       2-34         2.5.4.3.1       Description       2-34         2.5.4.3.2       Interface       2-38         2.5.4.3.3       Interface       2-38         2.5.4.4       Relay Command (Ordnance)       2-38         2.5.4.1       Interface       2-38         2.5.4.1.1       Pyrotechnic Firing Voltage       2-38         2.5.4.1.2       Firing Circuitry       2-38         2.5.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2-38         2.5.4.4.1.3       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Description       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Digital Telltale       2-50         2.6.1.2.2       Digital Telltale       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.5	2.5.4.1	Logic Pulse Command	2-30
2.5.4.1.2       Interface       2.30         2.5.4.2.1       Interface       2.34         2.5.4.3       Relay Command (Switched Power)       2.34         2.5.4.3.1       Description       2.34         2.5.4.3.2       Interface       2.38         2.5.4.4       Relay Command (Ordnance)       2.38         2.5.4.4.1.1       Pyrotechnic Firing Voltage       2.38         2.5.4.4.1.2       Firing Circuitry       2.38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2.38         2.5.4.4.1.4       Pyrotechnic Circuit Shields       2.42         2.5.4.5       Remote Relay Command       2.42         2.5.4.       Remote Relay Command       2.42         2.6.1       Data Handling Component Interfaces       2.42         2.6.1       Data Handling Component Interfaces       2.42         2.6.1.1.1       Description       2.42         2.6.1.2.1       Digital Telltale       2.5         2.6.1.2.2       Interface       2.44         2.6.1.3.1       Description       2.5         2.6.1.3.2       Description       2.5         2.6.1.3.1       Description       2.5         2.6.1.4.2       Description	2.5.4.1.1		
2.5.4.2.1       Interface       2.34         2.5.4.3.1       Description       2.34         2.5.4.3.2       Interface       2.38         2.5.4.4.1       Relay Command (Ordnance)       2.38         2.5.4.4.1.1       Pyrotechnic Firing Voltage       2.38         2.5.4.4.1.2       Firing Circuitry       2.38         2.5.4.4.1.2       Firing Circuitry       2.38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2.38         2.5.4.4.1.4       Pyrotechnic Circuit Shields       2.42         2.5.4.5       Remote Relay Command       2.42         2.6.1       Data Handling Component Interfaces       2.42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2.42         2.6.1.2.1       Digital Telltale       2.50         2.6.1.2.2       Digital Telltale       2.50         2.6.1.2.1       Description       2.50         2.6.1.2.2       Interface       2.50         2.6.1.3.1       Description       2.50         2.6.1.3.2       Interface       2.50         2.6.1.4.1       Description       2.50         2.6.1.5.1       Description       2.50         2.6.1.5.2       Interface	2.5.4.1.2	Interface	2-30
2.5.4.3       Relay Command (Switched Power)       2-34         2.5.4.3.1       Description       2-34         2.5.4.3.2       Interface       2-38         2.5.4.4.1       Interface       2-38         2.5.4.4.1.1       Pyrotechnic Firing Voltage       2-38         2.5.4.4.1.2       Firing Circuitry       2-38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2-38         2.5.4.4.1.4       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Digital Telltale       2-50         2.6.1.2.1       Description       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.1       Description       2-50         2.6.1.4.1       Description       2-50         2.6.1.5.1       Description       2-50         2.6.1.5.2       Interface <td>2.5.4.2</td> <td>Data Command</td> <td>2-30</td>	2.5.4.2	Data Command	2-30
2.5.4.3.1       Description       2-34         2.5.4.3.2       Interface       2-38         2.5.4.4.1       Interface       2-38         2.5.4.4.1.1       Pyrotechnic Firing Voltage       2-38         2.5.4.4.1.2       Firing Circuitry       2-38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2-38         2.5.4.4.1.4       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Digital Telltale       2-50         2.6.1.2.1       Discription       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.5.1       Description       2-50         2.6.1.4.1       Description       2-50         2.6.1.5.1       Description       2-50 <td>2.5.4.2.1</td> <td></td> <td></td>	2.5.4.2.1		
2.5.4.3.2       Interface       2-38         2.5.4.4.1       Interface       2-38         2.5.4.4.1.1       Pyrotechnic Firing Voltage       2-38         2.5.4.4.1.2       Firing Circuitry       2-38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2-38         2.5.4.4.1.4       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Interface       2-44         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.5.1       Description       2-55 <td>2.5.4.3</td> <td></td> <td></td>	2.5.4.3		
2.5.4.4.1       Interface       .238         2.5.4.4.1.1       Pyrotechnic Firing Voltage       .238         2.5.4.4.1.2       Firing Circuitry       .238         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       .238         2.5.4.4.1.4       Pyrotechnic Circuit Shields       .242         2.5.4.5       Remote Relay Command       .242         2.6       Spacecraft C&DH Subsystem - Data Handling Portion       .242         2.6.1       Data Handling Component Interfaces       .242         2.6.1.1       Description       .242         2.6.1.2.1       Interface       .244         2.6.1.2.1       Description       .242         2.6.1.2.2       Interface       .244         2.6.1.2.1       Description       .250         2.6.1.3.1       Description       .250         2.6.1.3.2       Interface       .250         2.6.1.3.1       Description       .250         2.6.1.4.2       Interface       .250         2.6.1.3.1       Description       .250         2.6.1.4.2       Interface       .250         2.6.1.4.1       Description       .250         2.6.1.5.1       Description       .255	2.5.4.3.1	Description	2-34
2.5.4.4.1       Interface       2-38         2.5.4.4.1.2       Firing Circuitry       2-38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2-38         2.5.4.4.1.4       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Interface       2-44         2.6.1.2.1       Description       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.3.3.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.5.2       Interface       2-50         2.6.1.5.1       Description       2-50         2.6.1.6.2       Interface       2-55         2.6.1.5.1       Description       2-55	2.5.4.3.2	Interface	2-38
2.5.4.4.1       Interface       2-38         2.5.4.4.1.2       Firing Circuitry       2-38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2-38         2.5.4.4.1.4       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Interface       2-44         2.6.1.2.1       Description       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.3.3.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.5.2       Interface       2-50         2.6.1.5.1       Description       2-50         2.6.1.6.2       Interface       2-55         2.6.1.5.1       Description       2-55	2.5.4.4	Relay Command (Ordnance)	2-38
2.5.4.4.1.2       Firing Circuitry       2-38         2.5.4.4.1.3       Pyrotechnic Safety Short And Arm Plugs       2-38         2.5.4.4.1.4       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6       Spacecraft C&DH Subsystem - Data Handling Portion       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Interface       2-44         2.6.1.2       Digital Telltale       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3       0-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.5.2       Interface       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55	2.5.4.4.1		
2.5.4.4.1.4       Pyrotechnic Circuit Shields       2-48         2.5.4.5       Remote Relay Command       2-42         2.6       Spacecraft C&DH Subsystem - Data Handling Portion       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Digital Telltale       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.3.3.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4.3       Description       2-50         2.6.1.5.1       Description       2-50         2.6.1.5.2       Interface       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55	2.5.4.4.1.1		
2.5.4.4.1.4       Pyrotechnic Circuit Shields       2-42         2.5.4.5       Remote Relay Command       2-42         2.6       Spacecraft C&DH Subsystem - Data Handling Portion       2-42         2.6.1.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Interface       2-44         2.6.1.2.1       Description       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3       0-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.5.1       Description       2-55         2.6.1.6.2       Interface       2-55 </td <td>2.5.4.4.1.2</td> <td>Firing Circuitry</td> <td>2-38</td>	2.5.4.4.1.2	Firing Circuitry	2-38
2.5.4.5         Remote Relay Command         2-42           2.6         Spacecraft C&DH Subsystem - Data Handling Portion         2-42           2.6.1         Data Handling Component Interfaces         2-42           2.6.1.1         Serial Digital - Science, Housekeeping, And Memory Dump         2-42           2.6.1.1.1         Description         2-42           2.6.1.2.2         Interface         2-44           2.6.1.2         Digital Telltale         2-50           2.6.1.2.1         Description         2-50           2.6.1.2.2         Interface         2-50           2.6.1.3.1         Description         2-50           2.6.1.3.2         Interface         2-50           2.6.1.3.1         Description         2-50           2.6.1.3.2         Interface         2-50           2.6.1.4         0 To +50mv Differential Analog Interface         2-50           2.6.1.4.1         Description         2-50           2.6.1.4.2         Interface         2-55           2.6.1.5.1         Description         2-55           2.6.1.5.2         Interface         2-55           2.6.1.5.1         Description         2-55           2.6.1.6.2         Interface         2-55 <td>2.5.4.4.1.3</td> <td>Pyrotechnic Safety Short And Arm Plugs</td> <td>2-38</td>	2.5.4.4.1.3	Pyrotechnic Safety Short And Arm Plugs	2-38
2.6       Spacecraft C&DH Subsystem - Data Handling Portion       2-42         2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.1       Description       2-42         2.6.1.2.1       Interface       2-44         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3       O-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4.3       O To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.4.3       Description       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.5.3       Interface       2-55         2.6.1.6.4       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock<	2.5.4.4.1.4	Pyrotechnic Circuit Shields	2-42
2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.2       Description       2-42         2.6.1.2.1       Interface       2-44         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3       0-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.5.3       Description       2-55         2.6.1.6.4       Description       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55	2.5.4.5	Remote Relay Command	2-42
2.6.1       Data Handling Component Interfaces       2-42         2.6.1.1       Serial Digital - Science, Housekeeping, And Memory Dump       2-42         2.6.1.1.2       Description       2-42         2.6.1.2.1       Interface       2-44         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3       0-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.5.3       Description       2-55         2.6.1.6.4       Description       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55	2.6	Spacecraft C&DH Subsystem - Data Handling Portion	2-42
2.6.1.1.1       Description       2-42         2.6.1.2.2       Digital Telltale       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5       Description       2-55         2.6.1.5.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0 <td< td=""><td>2.6.1</td><td>Data Handling Component Interfaces</td><td>2-42</td></td<>	2.6.1	Data Handling Component Interfaces	2-42
2.6.1.1.1       Description       2-42         2.6.1.2.2       Digital Telltale       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-50         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5       Description       2-55         2.6.1.5.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0 <td< td=""><td>2.6.1.1</td><td>Serial Digital - Science, Housekeeping, And Memory Dump</td><td>2-42</td></td<>	2.6.1.1	Serial Digital - Science, Housekeeping, And Memory Dump	2-42
2.6.1.1.2       Interface       2-44         2.6.1.2       Digital Telltale       2-50         2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3       0-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1	2.6.1.1.1	Description	2-42
2.6.1.2.1       Description       2-50         2.6.1.2.2       Interface       2-50         2.6.1.3       0-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.5.3       Interface       2-55         2.6.1.6.4       Description       2-55         2.6.1.6.5       Interface       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7.1       General       2-63         2.7.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1	2.6.1.1.2		
2.6.1.2.2       Interface       2-50         2.6.1.3       0-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.4       Description       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1.1	2.6.1.2	Digital Telltale	.2-50
2.6.1.3       0-5v Single Ended Analog Interface       2-50         2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.2.1	Description	2-50
2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.2.2	Interface	2-50
2.6.1.3.1       Description       2-50         2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6.3       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.3	0-5v Single Ended Analog Interface	2-50
2.6.1.3.2       Interface       2-50         2.6.1.4       0 To +50mv Differential Analog Interface       2-50         2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-55         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.3.1	Description	2-50
2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.3.2	Interface	2-50
2.6.1.4.1       Description       2-50         2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.4	0 To +50mv Differential Analog Interface	2-50
2.6.1.4.2       Interface       2-55         2.6.1.5       Temperature Sensor Interfaces       2-55         2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.4.1	Description	2-50
2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.4.2		
2.6.1.5.1       Description       2-55         2.6.1.5.2       Interface       2-55         2.6.1.6       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.5	Temperature Sensor Interfaces	2-55
2.6.1.5.2       Interface       2-55         2.6.1.6       Sun Pulse And Spin Clock       2-55         2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.5.1		
2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.5.2	Interface	2-55
2.6.1.6.1       Description       2-55         2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.6	Sun Pulse And Spin Clock	2-55
2.6.1.6.2       Interface       2-55         2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.6.1		
2.6.1.6.3       Sun Sensor Failure       2-63         2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.6.2		
2.7       Payload Instrument/Sensor Synchronization Signals       2-63         2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.6.1.6.3	Sun Sensor Failure	2-63
2.7.1       General       2-63         2.7.1.1       Available Synchronization Signals       2-63         3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.7	Payload Instrument/Sensor Synchronization Signals	2-63
2.7.1.1Available Synchronization Signals2-633.0Mechanical Interface Requirements3-13.1Instrument Physical Characteristics3-13.1.1Mass3-13.1.2Size3-1	2.7.1	General	2-63
3.0       Mechanical Interface Requirements       3-1         3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	2.7.1.1	Available Synchronization Signals	2-63
3.1       Instrument Physical Characteristics       3-1         3.1.1       Mass       3-1         3.1.2       Size       3-1	3.0	Mechanical Interface Requirements	3-1
3.1.1 Mass	3.1	Instrument Physical Characteristics	3-1
	3.1.1		
3.1.3 Center Of Mass	3.1.2		
	3.1.3	Center Of Mass	3-1

	*88898	A	7345-9012		
S	SCALE		DO NOT SCALE PRINT	SHEET	vii

3.1.4	Moments Of Inertia	
3.1.5	Mechanical Interface Drawings	3-1
3.2	Instrument Mounting	3-4
3.2.1	General	3-4
3.2.2`	Instrument Mounting Flange Specifications	3-5
3.2.3	Instrument Mounting Hardware Specifications	3-5
3.2.4	Mounting Hole Location Tolerance	
3.2.5	Instrument Mounting Repeatability	3-5
3.3	Alignment	3-5
3.3.1	Definition Of Spacecraft Axes	3-5
3.3.2	Definition Of Instrument/Sensor Optical Axes	
3.3.3	Alignment of Optical Axis	
3.4	Harness Tie Points	.3-10
3 <b>.</b> 5	Payload Instrument/Sensor Load Design	
3.5.1	General	
3.5.2	Load Directions	3-10
3.6	Payload Instrument/Sensor Protective Covers	.3-10
3.6.1	Non-Flight Protective Covers	.3-10
3.6.2	Flight Covers And Doors	
3.7	Payload Instrument/Sensor Unique Tooling and Handling Fixtures	
3.7.1	Optical Tooling	
3.7.2	Handling Fixtures	
3.8	Payload Instrument/Sensor Accessibility	
3.9	Payload Instrument/Sensor Identification And Marking	
3.10	Payload Instrument/Sensor Maintainability	.3-13
4.0	Payload Instrument/Sensor Thermal Interface Requirements	4-1
4.1	General	4-1
4.2	Spacecraft Thermal Design And Control	4-1
4.2.1	Spacecraft-Instrument Interface Temperatures	
4.3	Instrument Sensor Thermal Design And Control	
4.4	Payload Instrument/Sensor Space Environment Temperature Limits	
4.5	Observatory Test Temperature Limits	
4.6	Temperature Sensor Locations	
4.7	Payload Instrument/Sensor Thermal Model Analysis	.4-10
4.7.1	Thermal Model	
4.7.2	Geometry Model	.4-13
4.8	Thermal Control Devices	
4.8.1	Heaters	
5.0	Payload Instrument/Sensor Magnetic Interface Requirements	5-1
5.1	Instrument/Sensor Degaussing	5-1
5.2	Instrument Magnetic Fields	5-1
6.0	Payload Instrument/Sensor Electromagnetic Interface Requirements	
6.1	Program Requirements	
6.1.1	Objectives	6-1
7.0	Environmental Interface Requirements	7-1
8.0	Payload Instrument/Sensor Contamination Control	
8.1	General	
8.2	Purging	
8.2.1	Purge Connectors	
***		

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	viii

8.2.2	Purge Gas Flow Rate	8-3
8.2.3	Materials Outgassing	
9.0	Payload Instrument/Sensor Ground Support Equipment	
9.1	General	
9.2	Interface	
9.2.1	Telemetry Interface	9-1
9.2.2	Command Interface	9-1
9.2.3	Sun Sensor Interface	9-1
9.3	General Design Features	
9.3.1	Power	
9.3.2	Identification And Marking	
9.3.3	Calibration	
9.3.4	Documentation	
9.3.5	Radioactive Sources	
9.3.6	Thermal Vacuum Testing	9-4
10.0	Spacecraft Cable Responsibilities	10-1
10.1	General Policy	
10.2	Instrument Concern On Intra-Instrument Cabling	10-1
10.3	Conditions For General Policy Exceptions	10-1
10.4	Procedures For Intra Instrument Cabling Requests	10-3
11.0	Instrument/Sensor Integration	11-1
11.1	Delivery	11-1
11.2	Instrument/Sensor Receiving/Acceptance at JHU/APL	11-1
11.3	Pre-Integration Instrument/Sensor Interface Testing	
11.4	Comprehensive Performance Test	11-2
11.4.1	Comprehensive Performance Test Deliverables	11-2
	A Specfic Instrument Mechanical Interface Drawings	
APPENDIX	B Open Action Items	B-1

88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	ix

		:	

#### 1.0 GENERAL

This specification details the electrical, mechanical, thermal, and environmental interfaces between the instrument, named on the title page of this document, and the ACE spacecraft when the interface is not already defined by the ACE General Instrument Interface Specification (GIIS). The structure and section numbering of the GIIS and this document are correlated. The requirements of the GIIS apply, unless amended in the corresponding sections of the document. All instrument specific interfaces shall be documented in this specification.

#### 1.1 PURPOSE OF DOCUMENT

This document specifies the interface of ACE spacecraft and the instrument named in the title. This specification assumes interface conformance with the GIIS and shall document unique information and exceptions to the GIIS. **NOTE: Specific Instrument Interface information and comments are shown in bold type and a different font.** 

#### 1.2 OVERALL PROGRAM

The Advanced Composition Explorer mission is designed to observe particles, of solar, interplanetary, interstellar, and galactic origins, spanning the energy range from that of the solar wind to galactic cosmic rays. Definitive studies will be made of the abundance of all isotopes from hydrogen to zinc. Experimental studies will extend the isotope abundance range to zirconium.

ACE will be a coordinated effort to determine and compare the isotopic and elemental composition of several distinct samples of matter; the solar corona, the interplanetary medium, the local interstellar medium, and galactic matter. ACE will provide the first extensive tabulation of solar isotopic abundance's based on direct sampling of solar material.

The ACE Observatory will consist of the spacecraft bus and nine science instruments and a data processing unit (ULEIS) Specific instrument descriptions are contained in Figure 1.2-1.

#### 1.2.1 <u>Mission Operations</u>

Mission operations will be conducted by the Goddard Payload Operation Control Center (POCC). All science payload instrument mission operational constraints shall be communicated directly to the cognizant personnel at Goddard.

NOTICE: The spacecraft may be out -of -contact with ground stations for as much as 52 hours.

#### 1.3 APPLICABLE DOCUMENTATION

The documents listed below were used to guide the design of the ACE Spacecraft and the payload instrumentation and therefore are referenced in this Specific Instrument Interface Specification (SIIS), as applicable.

#### 1.3.1 NASA Documents

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	1-1

	GSFC-410-ACE-005 GSFC-410-ACE-003 GSFC-410-ACE-004	ACE Performance Assurance Requirements ACE Mission Requirements Document ACE Configuration Management Procedure
1.3.2	JHU/APL Documents	
	7345-9001	Design Specification for the ACE Spacecraft
	7345-9002 7345-9003	ACE Interface Control Documentation Plan APL Input to the ACE Observatory to DSN Interface Document
	7345-9004	APL Input to the ACE Observatory to Launch Vehicle Interface Document
	7345-9100 7345-9006 7345-9007	Spacecraft Assurance Implementation Plan ACE Observatory Integration and Test Plan ACE Environmental Defination, Spacecraft and Observatory Test Requirements and Instruments Test Recommendation Document (ACE
	7345-9100 7345-9101	Environmental Specification) S/C Assurance Implementation Plan (AIP) ACE Configuration Management
	7345-9010 7345-9011 7345-9012 7345-9013 7345-9014 7345-9015 7345-9016 7345-9017 7345-9018 7345-9019 7345-9020 7345-9020	CRIS - Specific Instrument Interface Specification SIS - Specific Instrument Interface Specification ULEIS - Specific Instrument Interface Specification SEPICA - Specific Instrument Interface Specification MAG - Specific Instrument Interface Specification SWICS - Specific Instrument Interface Specification SWIMS - Specific Instrument Interface Specification EPAM - Specific Instrument Interface Specification SWEPAM-E - Specific Instrument Interface Specification S3DPU - Specific Instrument Interface Specification SWEPAM-I - Specific Inst. Interface Specification SWEPAM-I - Specific Inst. Interface Specification ACE Contamination Control Plan
1.3.3	<b>Government Documents</b>	
	GSFC PPL-20 MIL-STD-975 (Grade 2) MIL-M-38510 MIL-STD-750 MIL-STD-883C MIL-STD-461B	GSFC Preferred Parts List NASA-STD (EEE) Parts List Microcircuit General Specification Methods for Semiconductor Devices Test Methods and Procedures for Microelectronics Electromagnetic Emission and Susceptibility Requirements for the Control of Electromagnetic Interference
	MIL-STD-462 (Notice 2) MIL-STD-480B	Measurement of Electromagnetic Interference Characteristics Configuration Control
	NASA Pub 1124	Outgassing for Spacecraft Materials

88898	A	оwg. no. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	1-2

NHB 5300.4 (3A-1)	Requirements for Soldering Electrical Connections
NHB 5300.4 (1C)	Inspection System Provisions
MIL-D-1000	Drawings, Engineering and Associated Lists
MIL-STD-100	Engineering Drawing Practices
MIL-C-45662	Calibration System Requirements
MSFC-SPEC-522A	Design Criteria for Controlling Stress Corrosion
MIL-STD-1629A	Failure Modes, Effects and Criticality Analysis
MIL-HDBK-5D	Metallic Materials and Elements for Aerospace
WILL-HODK-JD	Vehicle Structures
MIL-STD-889	Dissimilar Materials
MIL-HDBK-17A	Plastics for Aerospace Vehicles
MIL-HDBK-23A	Structural Sandwich Components
MIL-STD-1522	Standard General Requirements for Safe Design and
	Operation of Pressurized Missile and Space
	Systems
NSS/HP 1740.1	NASA Aerospace Pressure Vessel Safety Standards
MIL-B-5087B	Bonding, Electrical and Lightning Protection for
	Aerospace Systems
MIL-STD-1541	Electromagnetic Compatibility Requirements for
	Space systems
DOD-E-83578A	Explosive Ordnance for Space Vehicles, General
	Specifications for
GEVS-SE	General Environmental Verification Specification
	for STS and ELV Payloads, Subsystems and
	Components
MIL-P-55110	Printed Wiring Boards
MIL-STD-275	Printed Wiring for Electronic Equipment
MIL-S-19500	General Specification for Semiconductors
MIL-STD-202	Test Methods for Electronic and Electrical
	Components
FED-STD-209	Federal Standard Clean Room and Work Station
	Requirements, Controlled Environment
	<b>4</b>

#### 1.4 DOCUMENT CONFIGURATION

#### 1.4.1 Update and Change Control

The data contained in this document represent the current definition of the ACE Spacecraft Interface characteristics and limitations. This document, after formal release, shall be revised only through the formal change control procedures as described in the APL ACE Configuration Management Plan.

#### 1.5 DELIVERABLES

Each instrument/sensor provider shall deliver the items listed below for, or in support of, Observatory integration. Ground support equipment (GSE) consisting of hardware, software, and procedures, shall be shipped simultaneously or prior to the delivery of flight hardware. Safety rules, handling constraints and procedures, analytical models, analyses, drawings, test plans and procedures, test results, etc., shall be required prior to instrument delivery or as specified in the SIIS. Deliverables and their due dates are listed in Figure 1.5-1.

88898			9012	
SCALE		DO NOT SCALE PRINT	SHEET	1-3

#### Figure 1.5-1 ULEIS Instrument Deliverables

#### 1. Flight Hardware

- a. Data Processing Unit
- b. Analog Electronics Module
- c. Telescope
- d. Iris Mechanism (attached to front of Telescope)
- e. Telescope bracket, including thermal blankets, standoffs, mounting hardware, and grounding straps ( these items are manufactured by the S/C team

and supplied to the Instrument team at least a year prior to final instrument delivery)

- f. flight cables between DPU, Analog Electronics, Telescope, and Iris Mechanism
- g. connector covers for test ports

#### 2. GSE

- a. Shipping container(s) for the flight hardware
- b. Electrical GSE, including computer and stimulus units
- c. non-flight cables between GSE and test ports
- d. radioactive sources (temporarily installed on some of the detector collimators)
- 3. Documentation
  - a. Instrument data package, including functional test procedures and test results.
- 4. Delivery Date of the ULEIS instrument : On or before 7/9/96.

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	1-4

# 1.6 INSTRUMENT OPERATION AND HANDLING CONSTRAINTS AND HAZARDS

Each instrument/sensor experimenter shall summarize all constraints and hazards, which are applicable, to the handling and operation of their respective hardware. These constraints and hazards shall be listed in Figure 1.6-1.

FSCM NO.	SIZE	DWG, NO.		
88898	Α	7345-	9012	
SCALE		DO NOT SCALE PRINT	SHEET	1-5

Figure 1.6-1. ULEIS Instrument Operation and Handling Constraints

- 1. Telescope temperature maintained below 35 degrees C
- 2. Humidity maintained below 50%RH.
- 3. Instrument not handled unless Iris Mechanism cover is closed.
- 4. Instrument not handled unless member of instrument team is present.
- 5. Instrument has low level radioactive sources. Radioactive material handling procedures should be followed.
- 5. Care should be exercised to avoid marring thermal surfaces (radiator, conductive paints, etc.)
- 6. Good ESD handling procedures should be observed.
- 7. Telescope should only be lifted at designated points on the bracket. No lifting at detectors housings.
- 8. Only transported in approved shipping container.
- 9. High Voltage safeing plugs always installed except just prior to thermal vacuum test and launch.
- 10. MCP high voltage supplies only operated in vacuum and after sufficient outgassing.
- 11. Continous purge is required on telescope.
- 12. Front foil not exposed to direct sunlight under any circumstances.

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	1-6

#### 2.0 <u>ELECTRICAL INTERFACE REQUIREMENTS</u>

#### 2.1 GENERAL

The Command and Data Handling (C&DH) component receives, decodes and distributes spacecraft commands. It also receives, formats, stores, and transmits telemetry data from the instrument/sensor payloads and the spacecraft.

This C&DH subsystem provides the electrical interface between the ACE Spacecraft and the payload instruments/sensors.

Figure 2.1-1 presents a functional overview of the electrical interfaces between the spacecraft and the payload instruments/sensors.

#### 2.1.1 <u>C&DH Component Redundancy</u>

The C&DH subsystem will be redundant, thus providing complete interface redundancy to all instruments/sensors. Each instrument/sensor shall provide interfaces to each of the redundant C&DH spacecraft subsystems. These instrument interfaces shall insure that a failure on one side of the interface does not propagate to or affect operation of the redundant side.


Each instrument shall provide a method by which the C&DH component with active data handling functions can be selected by ground command. The ground command may be a data command or a logic pulse command.

For example, each instrument could generate a data handling select bit that would enable the data handling, sun pulse, and spin clock interfaces from one C&DH component, and disable the data handling, sun pulse, and spin clock interfaces from the other interfaces. One way to implement the data handling select bit is with a data command. One data command bit pattern (op code) could be used to configure instrument electronics to use the data handling, sun pulse, and spin clock interfaces from one C&DH component, and another bit pattern could be used to select the data handling, sun pulse, and spin clock interfaces from the other C&DH component.

Note: Each instrument/sensor shall have provisions to monitor and accept commands from either of the redundant spacecraft command components.


FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-1

Figure 2.1-1 Functional Block Diagram of ULEIS Electrical Interface

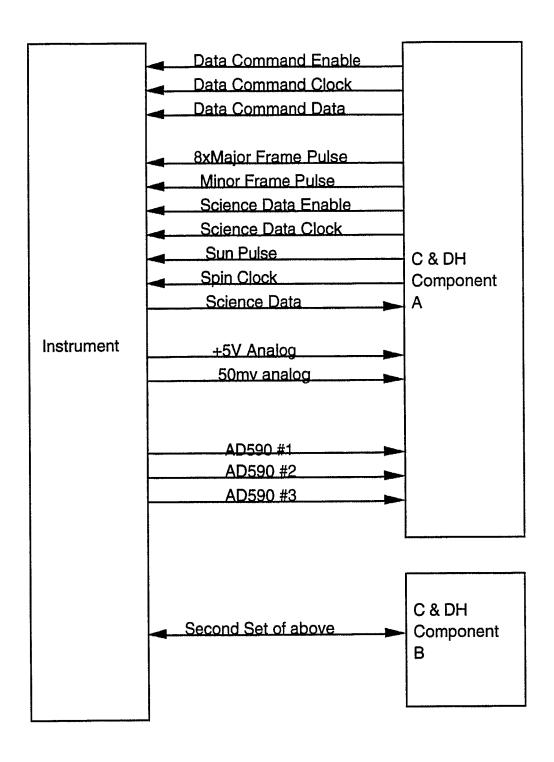

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-90	12	
SCALE		DO NOT SCALE PRINT	SHEET	2-2

Figure 2.1-1 Functional Block Diagram of ULEIS Electrical Interface (Cont.).

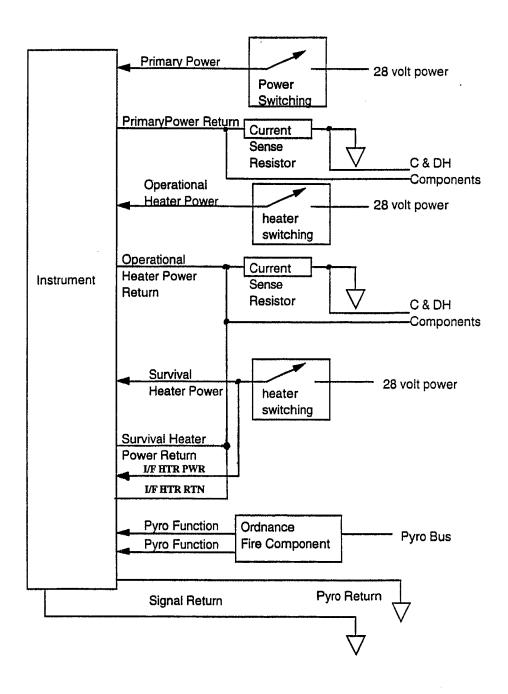

FSCM NO. <b>88898</b>	SIZE	DWG. NO.		
00090	<b>T</b>	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-3

#### 2.2 SYSTEM GROUNDING

#### 2.2.1 General

The ACE Spacecraft will employ a hybrid ground system to meet the many requirements of the Observatory and minimize electromagnetic and magnetic coupling between the payload instruments/sensors. A generalized master grounding diagram is shown in Figure 2.2.1-1. Instruments which have their secondary grounds referenced to the instrument chassis will be treated in detail in the SIIS.

#### 2.2.2 Instrument/Sensor Grounding

#### 2.2.2.1 Single Point Ground (SPG)

A Single Point Ground is provided on the ACE Spacecraft structure. For the payload instruments/sensors, the SPG shall be the bussing point to the spacecraft structure for primary (BUS) power returns only. The resistance between the SPG and the spacecraft structure shall not exceed 0.025 ohm.

#### 2.2.2.2 Chassis Ground

Every instrument/sensor chassis shall be electrically bonded directly to the spacecraft structure. Instruments which are thermally isolated shall be bonded by means of grounding straps. The resistance between the instrument/sensor structures and the spacecraft structure shall not exceed 0.025 ohm. Note: S/C shall provide grounding straps. Details are shown in Figure 2.2.2.4-1.

### 2.2.2.3 Primary D.C. Power Circuit Grounds

Primary power returns from the instrument/sensor power conversion circuitry shall be returned to the spacecraft primary power return bus as a twisted wires through the TLM current sensing resistors.

In each instrument, the dc resistance between the primary power leads, the primary power return leads and the instrument chassis shall be not less than 1 megohm.

# 2.2.2.4 Secondary D.C. Power Circuit Grounds

Secondary power returns, which have been isolated from the primary power return by means of a DC-to-DC converter, shall be referenced to the spacecraft single point ground (SPG). Instruments/sensors that must have secondary power returns common to the instrument chassis will be considered on a case-by-case basis. Specific Instrument grounding schemes are documented in Figure 2.2.2.4-1.

Instruments/sensors that distribute power from the secondary side of a common power supply located in one component, to electronics located in another component, by means of an intra-instrument harness/cable, shall provide a secondary power return lead that isolates return currents from the spacecraft chassis.


88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-4

Figure 2.2.1-1 Spacecraft Master Grounding Diagram F ROM ACE PS INST PRI RIN 8 SWITCHING INSTRUMEN PROCESSOR C DATA STORAGE POWER PS BEC RIN SPG ACE PSE INST SEC RIN ф ROW DAIVER CCCDT CSDH COLUMN CON CO FSCM NO. DWG. NO. SIZE 88898 7345-9012 SHEET SCALE DO NOT SCALE PRINT 2-5

Figure 2.2.2.4-1 ULEIS Instrument Grounding Diagram

The ULEIS instrument maintains isolation between the secondary signal return and chassis ground.

- 2. The ULEIS instrument telescope is mounted on a Spacecraft Team designed bracket. The telescope is thermally and electrically connected to this bracket. The bracket is thermally isolated from the deck. The bracket is electrically connected to the deck via ground straps.
- 3. The ground straps will be designed by the Bracket designer. The ground straps will be fabricated by the Spacecraft team. The telescope ground strap will be a conductor with high thermal resistivity.

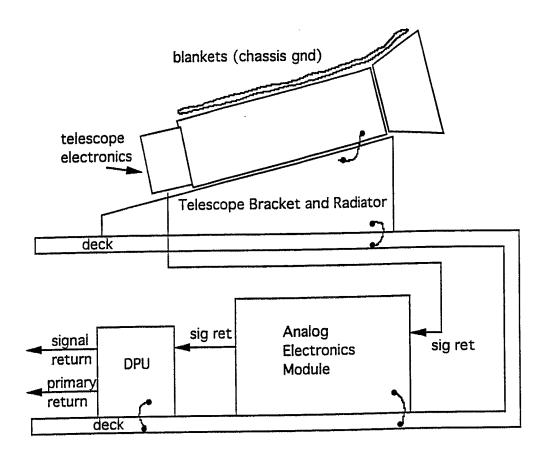

ſ	FSCM NO.	SIZE	DWG. NO.		
	88898	Α	7345-9012		
	SCALE		DO NOT SCALE PRINT	SHEET	2-6

#### 2.2.2.5 Signal Grounds

The signal return conductor is the return path for all low voltage signals generated or used by the instrument/sensor. This signal return/ground shall be isolated from the primary power supply and returns leads by at least 1 megohm when not connected to the SPG.

#### 2.2.2.6 Shield Grounds

At least one contact on each interface connector shall be provided for the purpose of shield grounding. Shields shall be grounded on the sending side only (except pyro shielding). Helo ring termination is acceptable.

#### 2.2.2.7 R.F. Bypassing

Primary power and return lines may be bypassed to the instrument/sensor chassis with feed-through, low inductance type, capacitors. The capacitors shall be less than, or equal to .01 microfarad per lead.

#### 2.2.2.8 Variations in Grounding Configuration

Certain variations to the grounding configuration described in the preceding paragraphs may be required to facilitate the use of existing equipment designs. These variations shall be identified in Figure 2.2.2.4-1.

#### 2.2.2.9 Wiring

The use of twisted wire for all power and pyro lines is required. The use of the spacecraft structure as a signal return is to be avoided. Any method of wiring which will reduce stray magnetic fields should be implemented. All pyro firing wiring shall be twisted and shielded. This wiring format shall extend from the pyro connector to the pyro device. Power wiring is twisted but not shielded.

#### 2.3 POWER

Power will be distributed to the instruments by relays in the Power Switching Component (PSC). The PSC is part of the C&DH subsystem. Each relay in the PSC may be controlled by either of the two redundant C&DH Components. Control of the relays is redundant, through the use of redundant relay coils; the relay contacts used to switch power are also redundant. The power switched by the relays will be provided over redundant wires to each instrument/sensor. Figure 2.3-1 illustrates a typical instrument/sensor power interface.


#### 2.3.1 <u>Power Interface Characteristics</u>

#### **2.3.1.1** Voltage

The spacecraft Power Bus shall provide  $28V \pm 2\%$ , excluding transients and ripple. Power will be provided by a two wire system (power and return) with the low side referenced to the spacecraft primary ground bus. Instrument/Sensor designers should consider

ı	FSCM NO.	SIZE	DWG. NO.		
8	88898	A	7345	-9012	
	SCALE		DO NOT SCALE PRINT	SHEE	et 2-7

Figure 2.3-1 Typical Instrument/Sensor Power Switching Interface

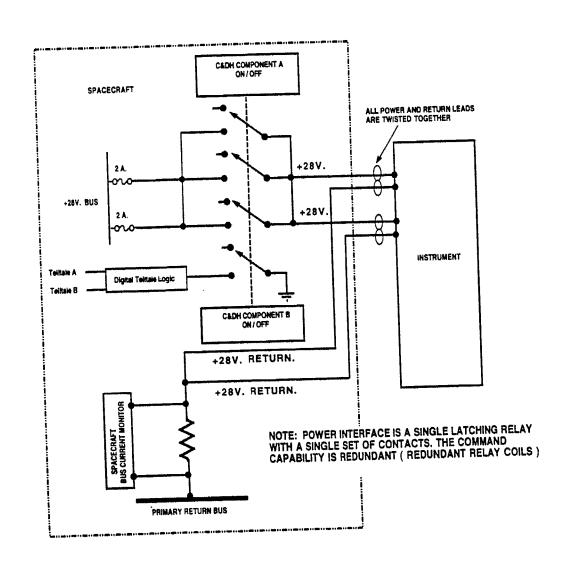

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-901	2	
SCALE		DO NOT SCALE PRINT	SHEET	2-8

the voltage drop at their instrument due to harness losses. The power harness shall be a minimum of two number 22 wires for both power source and return. The maximum harness length shall not exceed six feet.

#### 2.3.1.2 Power Allocation

The power allocation for each instrument/sensor shall be established and specified in each of the Specific Instrument Interface Specifications. After agreement on the power allocations, any change in power shall require the approval of a formal change request. Power estimates shall be provided to the ACE spacecraft interface manager and designers by each of the instrument/sensor experimenters; these estimates shall include no margins.

#### 2.3.1.3 Power Bus Source Impedance

The S/C power bus source impedance estimate is shown in Figure 2.3.1.3-1.

#### 2.3.1.4 Spacecraft Power Bus Normal Operation

Under normal operating conditions the spacecraft power bus shall have the following characteristics:

Bus voltage:

The bus shall remain at +28 VDC±2% except for load turn-on transients.

Load turn-on transient:

During load turn-on, the bus shall be limited to +26.88V and

shall return to +28VDC±2% within 15 milliseconds. Durning this time, the

maximum current step change is 5A (for transponder turn-on).

Load turn-off transient:

The bus turn-off transient is limited to +32V and will return to  $+28\pm2\%$ 

within 15 milliseconds.

Ripple:

The bus maximum ripple (at the user component) shall be less than 350mV p-p. Ripple bandwidth shall not exceed 100 MHz and shall be measured

with a bandwidth >100 MHz.

Spikes:

The bus maximum repetitive spike voltage shall be less than 0.5Vp-p.Short duration (less than  $50\,\text{ms}$ ) aperiodic transients and short duration components of long aperiodic transients shall be limited to a peak value less than three times the normal load voltage (i.e., 84V) and an impulse strength less than  $140\mu\text{V}$  seconds.


## 2.3.1.5 Spacecraft Power Bus Abnormal Operation

In the event of an overcurrent or undervoltage condition, the bus is protected by the C&DH subsystem which removes the instruments from the bus and then, if the fault persists, removes the non-critical spacecraft subsystems. Additional protection from short circuit loads is provided by the fuses in line with all bus loads.

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-9

Figure 2.3.1.3-1 Power Bus Source Impedance

# Combined Power Source, Cable & Contact Impedances

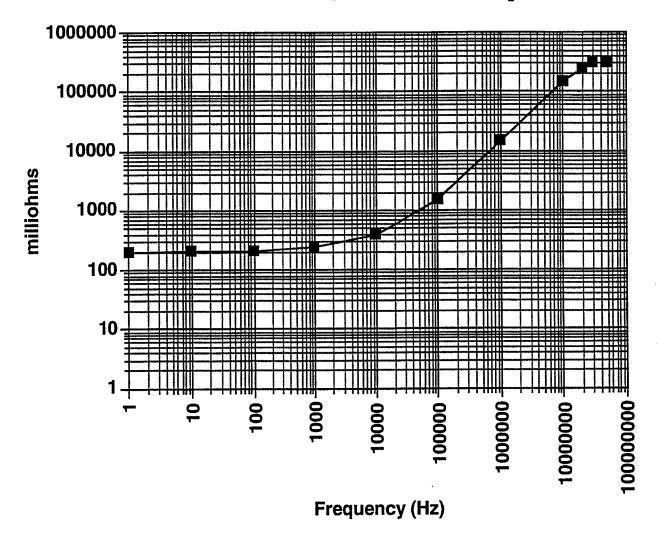

Data includes the power source, connectors, harness, relay contacts, solder joints and telemetry impedance seen by a load five feet (maximum instrument harness length) from the power source.

FSCM NO.	SIZE	DWG. NO.			
88898	Α	7345-9012			
SCALE		DO NOT SCALE PRINT	SHEET	2-10	

During fault clearing, the characteristics of the bus are as follows:

**Bus voltage:** Fault clearing shall not exceed 10 seconds. In the event of a bus short to ground (worst case fault), the main bus voltage may be brought down to the battery voltage (approximately 19.6 volts). This assumes that the short will not cause the component fuse to open during the 10 seconds. All the non-critical loads (and the ballast (shunt resistors) loads) will be removed rom the bus during the 10 seconds. When the fuse opens, only the critical spacecraft loads are powered and the bus voltage can jump to 36.6 volts for 15 milliseconds max before the bus returns to 28 V $\pm$  2%.

> During integration and test, there exists a small possibility of faults which could produce a bus voltage between 0 to 30 V for 2 minutes.

Surges:

Surges shall not exceed the range +18.9 to + 38 volts. The lower voltage, below the 26 v main bus trip point, shall last no longer than the time it takes to remove the non-critical loads (within 10 seconds). The upper voltage shall recover to normal operating voltage within 15 milliseconds.

#### 2.3.2 **Relay Considerations**

The Power Switching and Ordnance Fire Components are made up of 2, 5 and 10 amp. rated relays. These relays come in the latching and non-latching varieties. Typically the latching relays have 2 to 4 poles and the non-latching relays have 2 to 3 poles. The number of relays in a given component is dependent on the current rating (size) of relays and the configuration called out by the users.

Each C&DH Component issues commands to the relays in the Power Switching and Ordnance Fire Component with a selectable 20, 40, 60 or 80 millisecond pulse width. This action translates to a guaranteed 10, 30, 50, or 70 millisecond non-latching relay contact closure.


#### 2.3.2.1 **Turn-on Transients**


Peak turn-on transients shall not exceed the levels given in the text below and shall reach steady state operating current within 300 milliseconds. The turn-on transient maximum current rate of change shall not exceed 20mA per microsecond. See Figure 2.3.2.1-1. Specific instrument turn-on transient is shown in Figure 2.3.2.1-2.

- Instruments > 1A. The initial inrush current shall not exceed 2 times the normal operating current for the first 300 µs and 1.5 times the steady state current for the remaining time not to exceed 300 milliseconds for the total transient.
- Instruments < 1A. The initial inrush current shall not exceed 2 amp for the first 300 \( \mu \)s and 1.5 amps for the remaining time not to exceed 300 milliseconds for the total transient.

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-11

Figure 2.3.2.1-1 Envelope of Allowable In-rush Current

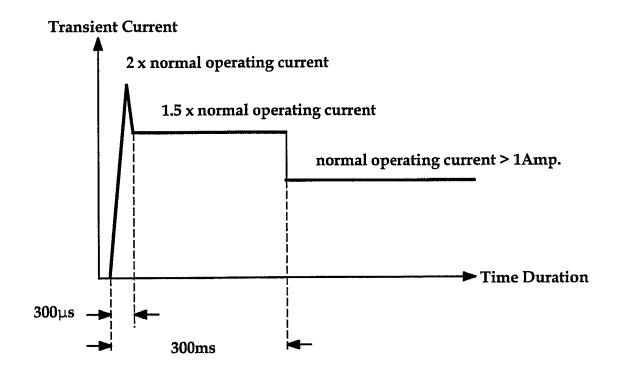


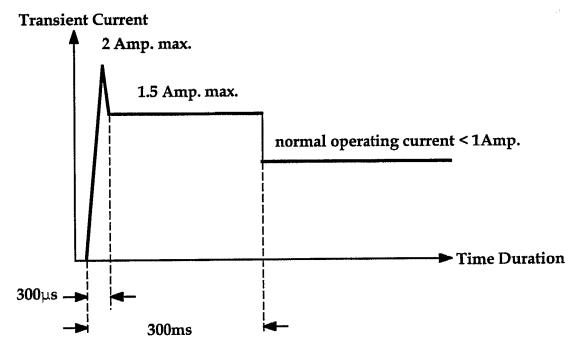


1	FSCM NO.	SIZE	DWG, NO.		
	88898	Α	7345-90	012	
	SCALE		DO NOT SCALE PRINT	SHEET	2-12

Figure 2.3.2.1-2 ULEIS Instrument Turn-on Transient Requirements

Due to the large turn-on transient of the ULEIS LVPS, 10 Amp relays are required for power switching.

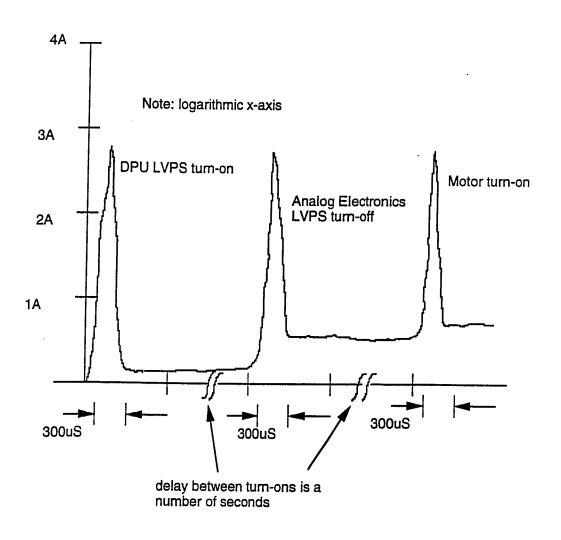



#### 2.3.2.2 Turn-off Transients

All inductive loads associated with the users, such as coils, shall be provided with suppression circuits to prevent damage to relay contacts, due to excessive transients during power interrupts.

#### 2.3.3 Power Wiring

Power will be distributed via unshielded twisted wires (quads) as described in Paragraph 2.2.2.3.

#### 2.3.4 Instrument/Sensor Power Profiles

Each instrument/sensor experimenter shall provide power profiles for all normal and known abnormal operating modes of their respective equipment, including turn-on and turn-off. The specific instrument power profiles are shown in Figure 2.3.4-1.

#### 2.4 CONNECTORS

#### 2.4.1 General

#### 2.4.1.1 Equipment Interface and Test Connector Selection

Interface and test connectors shall be Aerospace/Military designs for severe environmental applications. In order to minimize program connector types and reduce cost, it is desirable that standard connectors be used for all new equipment designed for the ACE program.

#### Preferred types are:

a) Rectangular connectors meeting the requirement of GSFC S-311-P-407, S-311-P-409, or S-311-P-10. (HD and HDD "D" type connectors)

If an instrument/sensor experimenter uses a connector not listed above, the instrument/sensor experimenter shall provide JHU/APL mating connectors for all interfaces with the spacecraft. The experimenter shall supply all mating connectors which do not directly interface with the spacecraft no matter what connector type is used. (See also Section 10.) Specific instrument connector data are shown in Figure 2.4.1.1-1.


#### 2.4.1.2 Magnetic Properties

The payload instrument/sensor interface connectors shall be made of non-magnetic materials in order to limit magnetic contamination of the ACE Observatory. **Exceptions shall be noted in Figure 2.4.1.1-1**. Samples of non-conforming connectors shall be provided for magnetic testing.

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-14

Figure 2.3.4-1 ULEIS Power Profile

#### Motor operation in the emergency mode may be as much as 8 watts.

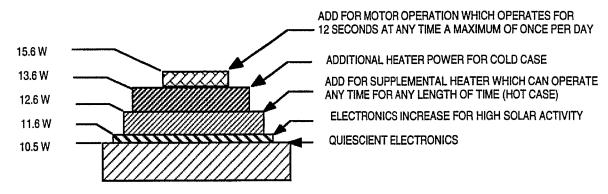

#### NOTE:

CURRENT PAYLOAD INSTRUMENT POWER DATA ARE CONTAINED IN THE CALTEC DOCUMENT ACE-CT-100-40. THIS DOCUMENT SHALL BE CONSULTED FOR CURRENT POWER LEVELS.

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-15

Figure 2.4.1.1-1 ULEIS Connector Data

CONNECTOR DESIGNATION	CONNECTOR TYPE	CONNECTOR PART NUMBER
A1010-J8	15 Pin Male	311P407-1P-B-15
A1020-J3	DB9 Male	SC56-702-005*
A1020-J4	DB15HD Male	SC56-601-020*
A1020-J5	26 Pin Male	311P407-2P-B-15
A1030-J11	9 Pin Male	311P409-1P-B-15
A1030-J12	2 Pin Pigtail M/F	JF1S-1PB-(95)

<sup>\*</sup> Spectrum Control

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9	9012	
SCALE		DO NOT SCALE PRINT	SHEET	2-16

# 2.4.2 <u>ACE Spacecraft/Instrument Interface Connectors</u>

#### **2.4.2.1** General

The following guidelines shall be followed for all instrument/sensor connectors which interface with the spacecraft subsystems.

- a) Instrument/sensor power and interface connectors shall be located and spaced so that they can be readily and safely mated and demated during the integration and test phases of the program.
- b) Primary Bus Power feed and return interfaces shall be contained in a separate male connector. In the event that this requirement cannot be met, all power and return interfaces shall be in the same connector.
- c) Multiple connectors shall be of different sizes or shall be uniquely keyed in order to minimize mating errors.
- d) All interface connectors shall be uniquely identified. J-numbers shall be assigned by the instrument/sensor experimenter.
- e) Connector covers shall be provided by the instrument/sensor experimenter for all connectors which do not interface with the spacecraft during flight.
- f) Connectors which use crimped contacts shall have the spare and unused pin locations populated.
- g) Torque requirements for installation of all interface connectors, protective covers, or flight plugs shall be defined by the instrument/sensor experimenter and documented by connector number in this SIIS. Preferred connectors are exempt.

#### 2.4.2.2 Pin Assignments


The instrument/sensor experimenter shall identify pin assignments for all instrument/sensor interfaces with the spacecraft. **Instrument pin assignments are documented in Figure 2.4.2.2-1**. The following are connector pin assignment guidelines:

- a) Redundant wires and connector pins shall be used for all primary bus power inputs and returns.
- b) Pin assignments shall be made in a manner that will reduce signal crosstalk.
- c) Signal and signal returns shall be located on adjacent pins to facilitate wire twisting and shielding.

1	FSCM NO.	SIZE	DWG. NO.		
	88898	A	7345-9012		
	SCALE		DO NOT SCALE PRINT	SHEET	2-17


Figure 2.4.2.2-1 ULEIS/Spacecraft Interface Connector Pin Assignments

## A1020-J3 POWER INTERFACE CONNECTOR

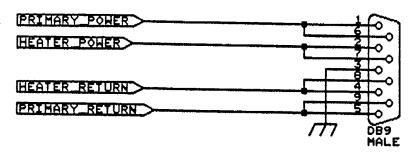

SPECTRUM CONTROL 56-702-005 4000pf Pi Filter

#### A1020-J4 TELEMETRY INTERFACE CONNECTOR

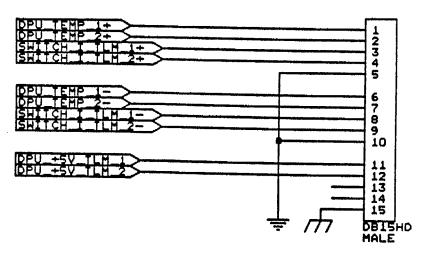

SPECTRUM CONTROL 56-601-020
INSULATED PIN FEEDTHRU FILTER

Г	SCM NO.	SIZE	DWG, NO.		
	88898	A	7345-9012		
[	SCALE		DO NOT SCALE PRINT	SHEET	2-18

Figure 2.4.2.2-1 ULEIS/Spacecraft Interface Connector Pin Assignments (cont.)


## A1020-J5 DATA CONNECTOR

DATA PROCESSOR	DATA CHANGED SINCE Rev Change Affects Pins 1,2,3,5 Change Date: 11/1/95
26-pin high density	ECR Number 2014
J5 (male)	LOIT Number 2014
311P407-2P-B-15	
P5 (female)	
311P407-2S-B-15	
DATA CONNECTOR	·
1	CMD GATE-2
2	CMD DATA-1
3	CMD CLOCK-1
4	CHASSIS GROUND
5	CMD GATE-1
6	CMD CLOCK-2
7	CMD DATA-2
8	CHASSIS GROUND
9	SIGNAL GROUND
10	SIGNAL GROUND
11	
12	MINOR FRAME-1
13	TLM GATE-1
14	TLM CLOCK-1
15	TLM DATA-1
16	8X MAJOR FRAME-1
17	SUN PULSE-1
18	SUN PULSE-2
19	
20	MINOR FRAME-2
21	TLM GATE-2
22	TLM CLOCK-2
23	TLM DATA-2
24	8X MAJOR FRAME-2
25	SPIN CLOCK-1
26	SPIN CLOCK-2

FSCM NO. 88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-19

Figure 2.4.2.2-1 ULEIS/Spacecraft Interface Connector Pin Assignments (cont.)

#### A1030-J11 PYRO INTERFACE CONNECTOR

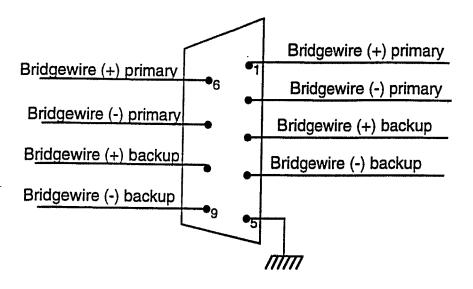


A1030-J11 311P409-1P-B-15

Pyro connector on UMd Telescope Box

FSCM NO.	SIZE	DWG, NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-20

Figure 2.4.2.2-1 ULEIS/Spacecraft Interface Connector Pin Assignments (cont.)

## A1010-J8 ANALOG TELEMETRY INTERFACE CONNECTOR

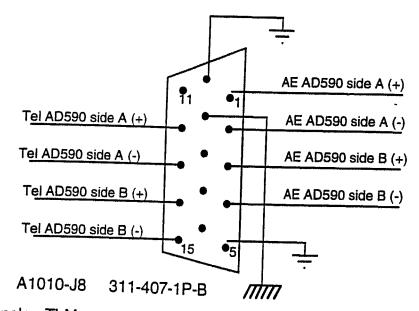


Analog TLM connector on UMd Analog Electronics Box

88898	A	DWG. NO. 7345-90	012	
SCALE		DO NOT SCALE PRINT	SHEET	2-21

Figure 2.4.2.2-1 ULEIS/Spacecraft Interface Connector Pin Assignments (cont.)

#### A1030-J12 SURVIVAL HEATER CONNECTOR

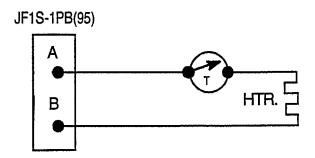

FSCM NO.	SIZE	DWG, NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-22

#### 2.4.3 <u>Test and GSE Interface Connectors</u>

Electrical interfaces required by an instrument/sensor for special test purposes, at the Observatory level, shall have a separate connector from those which interface with the spacecraft. These direct access connectors shall be the responsibility of the instrument/sensor designer and shall be identified in Figure 2.4.3-1 if the connector is necessary for spacecraft integration. All test connectors shall be readily accessible at the Observatory level. These test connectors should be female. All associated test harnesses shall be removed before flight. These connectors shall be covered before flight and when not in use (green tag item).

#### 2.4.4 Flight Plugs and Locations

Flight plugs requiring installation or removal prior to launch shall be identified and the locations specified in Figure 2.4.4-1. Plugs shall be supplied by the Experimenter and shall be accessible at the Observatory level. Flight plugs shall be color coded as follows: NONFLIGHT -- RED; FLIGHT -- GREEN.

#### 2.4.4.1 Special Connector Plugs

Special plugs such as high voltage enable, disable, etc. may be used to control a component prior to launch. **These plugs shall be identified in Figure 2.4.4.1-1** These plugs shall as follows: NONFLIGHT -- RED; FLIGHT -- GREEN.

#### 2.4.5 Payload Stimulus and Monitor Interface

When required by the payload, stimulus and monitor interfaces shall be provided for the payload instruments through the spacecraft umbilical connector. These interfaces shall be identified in Figure 2.4.5-1 and are the responsibility of the instrument/sensor experimenter. The number of these interfaces is severely limited and will require negotiation with the spacecraft.

All umbilical level interfaces shall be buffered to prevent damage to the spacecraft in the event of problems which may occur on the umbilical lines or within support equipment.

FSCM NO.	SIZE	DWG. NO.			
88898	Α	7345-9012			
SCALE		DO NOT SCALE PRINT	SHEET	2-23	

## Figure 2.4.3-1 ULEIS Test and GSE Interface Connector Information

This connector is for the use of the IDT only.

FSCM NO.	SIZE	DWG. NO.			
88898	Α	7345-9012			
SCALE		DO NOT SCALE PRIN	(T	SHEET	2-24

## Figure 2.4.4-1 Location and Use of ULEIS Flight Plugs

There is a red tagged safeing plug on the high voltage power supply nearest the front of the telescope which must be removed just prior to flight.

There may be green tagged connector covers for the test connectors on the telescope.

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-25

## Figure 2.4.4.1-1 ULEIS Special Connectors/Plugs

ULEIS does not have any special connectors or plugs other than the tagged items described in Figure 2.4.4-1

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9	0012	
SCALE		DO NOT SCALE PRINT	SHEET	2-26

## Figure 2.4.5-1 Payload Stimulus and Monitor Interfaces with the S/C through the Umbilical Connector

There are no payload stimulus interfaces that use the umbilical connector. ULEIS requires that the Sun Pulse, spin clock, and 8xMajor Frame pulse be available for monitoring by our GSE during Integration and Test.

FSCM NO.	SIZE	DWG. NO.	····	
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-27

## 2.5 Spacecraft Command and Data Handling Subsystem

The spacecraft Command and Data Handling (C&DH) Subsystem consists of two C&DH Components, a Power Switching Component, an Ordnance Fire Component, and two data recorders (see Figure 2.5-1 for the C&DH subsystem block diagram). Each C&DH component is part of one of two "strings" of spacecraft components. Each string includes a command receiver, telemetry transmitter, Sun Sensor, and C&DH component. Control of the Power Switching component and Ordnance Fire Component is cross-strapped to both C&DH components. The two Data Recorders are cross-strapped to both strings. Operationally, only one of the strings will be used unless a failure occurs in that string. A failure would be detected by the mission operations center, not autonomously detected onboard. Each instrument must be aware which string is active.

## 2.5.1 C&DH Component Command Acceptance

Both C&DH components are always capable of executing commands; typically, only one component will be used to execute commands. Each C&DH component receives telecommand frames from the ground. Each telecommand frame contains one or more instrument or spacecraft commands. It is only possible to address a telecommand frame to one of the two C&DH components, therefore only one C&DH component at a time will execute and output uplinked commands. Telecommand frames are checked for errors before any command in the frame is executed. If any error is found, the entire telecommand frame is rejected. An uplink protocol is used to prevent a telecommand frame from being processed if the previous telecommand frame was rejected. Therefore, execution order of a sequence of commands can be guaranteed, both within a telecommand frame and for a command sequence that extends over multiple telecommand frames. In addition to error detection at the telecommand level, individual commands also contain an error detection code. A command will not be executed if an error is detected.

## 2.5.2 Command Execution - Real-time


A telecommand frame can contain a combination of commands that are to be executed immediately and commands that are to be stored for future execution. Commands that can be executed immediately upon reception by the C&DH component are known as real-time commands.

## 2.5.3 Command Execution - Stored

Three types of stored commands can be specified: Time Tagged, Autonomy, and Block commands. A Time Tagged command is stored for execution at a specific spacecraft time count. It is stored in C&DH memory with an associated time tag. When the current spacecraft time count matches the stored time tag, the command is executed. Time tagged commands are scanned once a second. An Autonomy command is stored for execution based on the value of a particular byte of housekeeping telemetry. An autonomy command is stored with a rule. The rule contains a pointer to a specific byte of telemetry, and a comparison of that byte of telemetry to a fixed value or range. If the comparison becomes true, the autonomy command associated with the rule is executed. Autonomy rules are evaluated once per second. The rule can be required to be true multiple times before the command is executed. Autonomy commands, including the telemetry byte pointer and comparison value(s), can be reloaded by

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-28

Figure 2.5-1 C&DH Subsystem Block Diagram

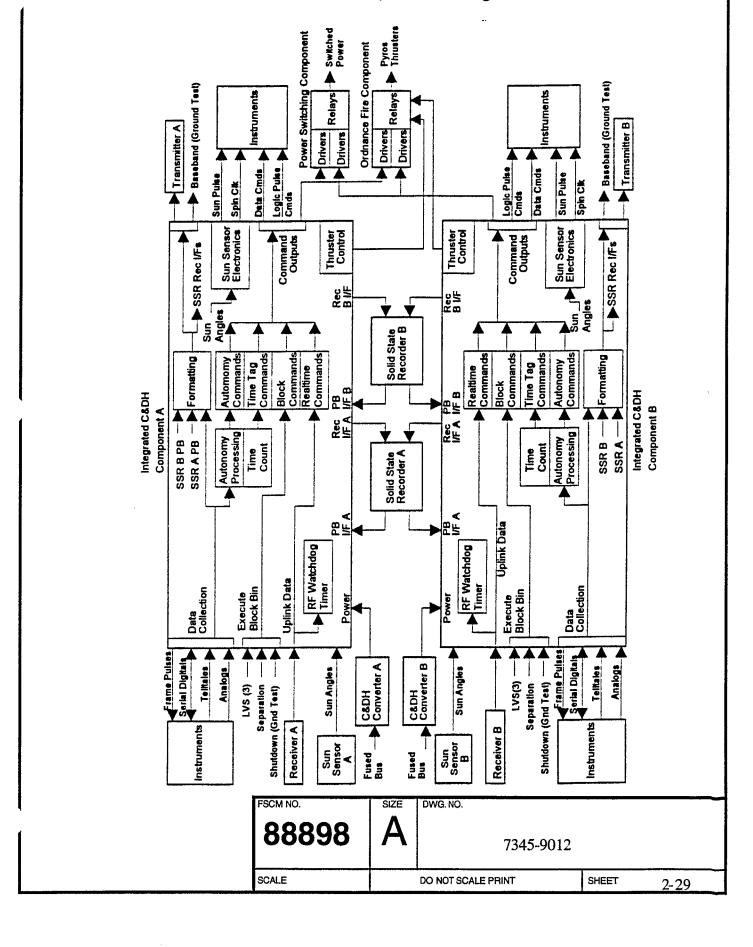

ground command. Finally, a Block command can be stored as a part of a group of commands. Blocks allow for sequences of greater than one command to be executed based on a single event. Commands in a block are executed based on the execution of a Block Bin Execute command, or in special cases in response to an event such as Low Voltage Sense. A Block Bin Execute command can itself be a real-time, block time tagged, or autonomy command.

#### 2.5.4 <u>C&DH Subsystem Command Interfaces</u>

The C&DH Subsystem provides four types of command interfaces. These are the Logic Pulse, Data, Relay and Remote Relay command interfaces. The Logic Pulse and Data Command interfaces are duplicated on each C&DH Component and the user needs to accommodate the redundant interfaces. Care should be taken with instrument input design, because both command interfaces are powered, in the high impedance off state, throughout the ACE mission. In the case of instruments with largely CMOS circuits, this can mean that parts of the instrument could be powered from sneak paths through diodes to the rails of the input buffers. The recommended first circuit should be used to ensure compatibility with the C&DH components.

#### 2.5.4.1 Logic Pulse Command

The Logic Pulse interface provides a 40-millisecond transistor switch closure to ground. An instrument should always listen to the Logic Pulse interfaces from both C&DH components, although only one is active at a time. The low power circuit suggested for the user makes use of the CD4050 with a small hysteresis feedback resistor. The CD4050 is suggested due to the lack of input diodes to the power rail. A filter is suggested to reduce the interfaces susceptibility to noise.

#### **2.5.4.1.1 Description**

The Logic Pulse command provides a 40-millisecond transistor switch closure to ground. A logic pulse timing diagram is shown in Figure 2.5.4.1.1-1.

#### **2.5.4.1.2** Interface


The standard interface is shown in Figure 2.5.4.1.2-1. The instrument shall include a separate interface for each C&DH Component. The components used to implement the interfaces to each of the C&DH Component shall be physically distinct and separate; no single part shall serve both redundant circuits. Specific instrument logic pulse interface is shown in Figure 2.5.4.1.2-2.

#### 2.5.4.2 Data Command

The Data Command provides variable length data to the instruments. An output data length from 8 to 4096 bits in multiples of 8 bits is acceptable. Note: no header or checksum is added to the data by the C&DH component; the C&DH component acts as a bent-pipe. The gated output clock sets the data rate at  $1200 \pm 3\%$  bits per second. Consecutive data command outputs may follow as close as one millisecond, longer time intervals are possible. An instrument should always listen to the data command interfaces from both of the C&DH components although only one is active at a time.


88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-30

Figure 2.5.4.1.1-1 Logic Pulse Command Timing

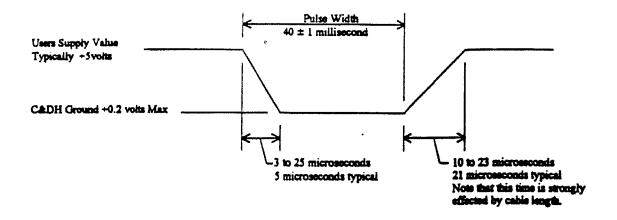

FSCM NO.	SIZE	DWG. NO.			
88898	Α	7345-9012			
SCALE		DO NOT SCALE PRIN	IT	SHEET	2-31

Figure 2.5.4.1.2-1 Logic Pulse Interface

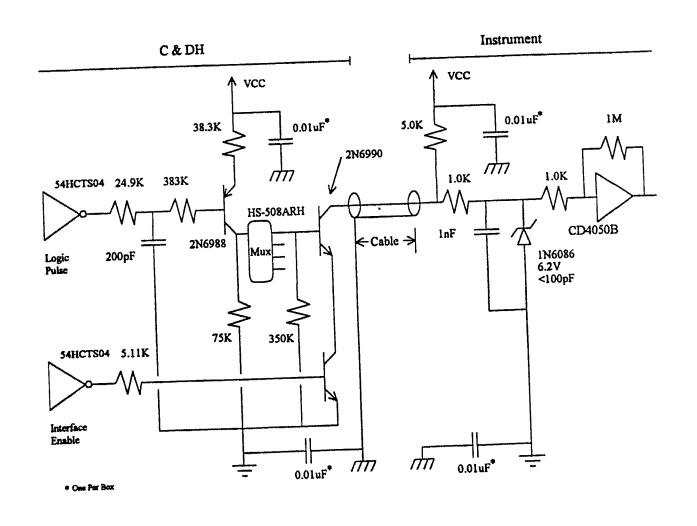

FSCM NO. 88898	A	DWG. NO. 7345-901	12	
SCALE		DO NOT SCALE PRINT	SHEET	2-32

Figure 2.5.4.1.2-2 ULEIS Logic Pulse Interface

ULEIS does not require logic pulse commands.

 The data are conveyed across a three signal interface (Enable, Clock and Data). The timing diagram of Figure 2.5.4.2-1 depicts the signals' relationships. The gated clock has a 50% duty cycle when present; the gated clock is only present when the data are actually being sent. The enable is an active low signal that will transition at least one quarter of a bit time before the clock transitions from high to low. Data is valid on the falling edge of the clock and will change on the rising edge. The enable will be removed with the rising edge of the clock on the last data bit transferred.

Memory load will be accomplished over the data interface using a maximum of 4096 bits in increments of 8 bits. Memory loads using a data command are treated identically by the C&DH component as any other type of data command.

#### 2.5.4.2.1 Interface

The first level circuit diagram of Figure 2.5.4.2.1-1 is the suggested data interface. An advantage to this circuit is the high level reference is user supplied. Both interfaces depict a single C&DH component data command interface with the instrument. The instrument must make provision to accept these interfaces. Input buffers to one C&DH component should not share the same package with buffers to the second C&DH component. An instrument should not wired"or-ed" together the buffered data, clock and enable lines from one C&DH component with the equivalent signals from the other C&DH components. Specific instrument data command interface is shown in Figure 2.5.4.2.1-2.

#### 2.5.4.3 Relay Command (Switched Power)


#### **2.5.4.3.1 Description**

Relay Commands control switched power for the spacecraft. The relays used for switching the power are grouped into two categories, Ordnance and Power Switching. The Ordnance Fire Component is responsible for switching power to the Ordnance on board the spacecraft. The Power Switching Component supplies switched power to the users on the spacecraft.

Latching relays are not redundant for these interfaces. In general, there are multiple contacts in each relay. Each relay contains two coils. One of the coils is controlled by C&DH component A and the other coil is controlled by C&DH component B. For relays switching power, the harness will contain one more wire than is required to carry the power to the user. Latching relays will utilize one contact as a position indicator. The state of the indicator is telemetered to the ground.


88898	A	DWG. NO. 7345-9	0012	
SCALE		DO NOT SCALE PRINT	SHEET	2-34

Figure 2.5.4.2-1 Data Command Timing

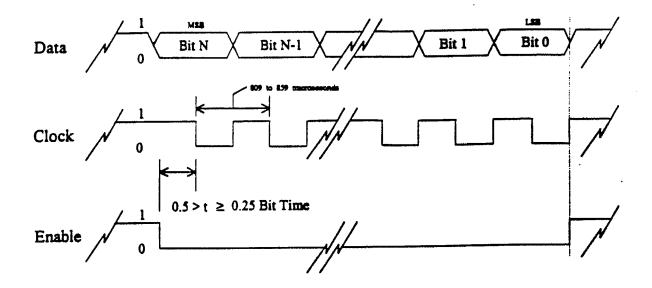

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-	9012	
SCALE		DO NOT SCALE PRINT	SHEET	2-35

Figure 2.5.4.2.1-1 Data Command Interface

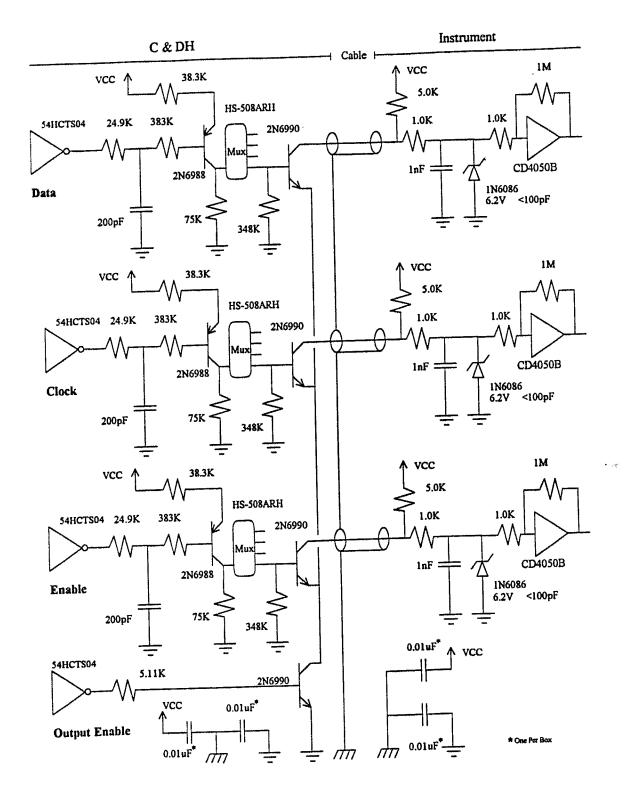


FSCM NO. 88898	A	DWG. NO.	7345-9012		
SCALE		DO NOT SCALE	PRINT	SHEET	2-36

Figure 2.5.4.2.1-2 ULEIS Data Command Interface

The ULEIS command interface conforms to the standard interface circuits exactly as shown in the GIIS.

NOTE: Successive commands must always be separated by a minimum of one second.

This Mission Operation constraint is included here for the information of the reader.

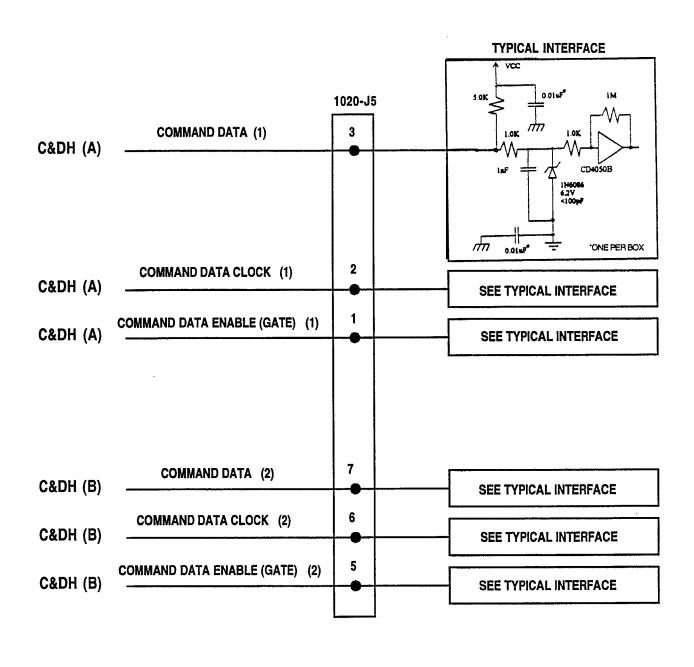

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9012	_	
SCALE		DO NOT SCALE PRINT	SHEET	2-37

#### **2.5.4.3.2** Interface

The following illustrates the typical power switching relay interface (see Figure 2.3-1). Relays are redundant at the coil level. The wires to the user will contain one more than necessary to carry the current. The current in the return line is sensed with a current sensing resistor on a spacecraft terminal board. The instrument power relay interface is shown in Figure 2.5.4.3.2-1.

#### 2.5.4.4 Relay Command (Ordnance)

#### **2.5.4.4.1** Interface

The following illustrates a typical Ordnance Fire Interface (Figure 2.5.4.4.1-1). Notice the enable relay in series with the actual fire relay. The Ordnance Fire Component also provides 100 ohm resistors to ground in the safe position of the fire relay. The resistors in series with each ordnance is to current limit the ordnance line. Instruments shall specify minimum all fire current, recommended all fire current, maximum all fire current, maximum fire current, and maximum no fire current.

The diagram in Figure 2.5.4.4.1-1 illustrates the wiring for the Ordnance used by a user with two redundant pyros. The Ordnance Fire Component uses one enable relay for multiple pyro, in this case two "A" and "B." Each pyro has a primary and backup side. Both primary and back-up pyros may be fired simultaneously, if specified in Figure 2.5.4.4.1-2. Not shown are the relay coils that are driven from each C&DH component. The exact ordnance relay configuration for each instrument is documented in the instrument SIIS. The requirements of Eastern Range Requirement Document (127-1) will apply except as noted in the SIIS. Pyrotechnic circuits shall be isolated from all other instrument circuits. A separate pyro connector shall be used. The instrument ordnance fire interface is shown in Figure 2.5.4.4.1-2.

#### 2.5.4.4.1.1 Pyrotechnic Firing Voltage

Pyrotechnic firing voltage will be between 19 and 27 VDC; no fuses will be used in the pyrotechnic firing circuit. The pyrotechnic firing bus will be redundant.

#### 2.5.4.4.1.2 Firing Circuitry


Firing of pyrotechnics is the responsibility of the ACE spacecraft. Each firing circuit shall be separately switched and consist of a shielded, twisted drive/return line pair. Firing of pyrotechnics shall require separate enable sequence and fire commands.

## 2.5.4.4.1.3 Pyrotechnic Safety Short and Arm Plugs

Each pyrotechnic device, when practical, shall have a shorting device at the ordnance element which is accessible without disassembly of the instrument/sensor at the Observatory level. The spacecraft will have pyrotechnic arming plugs that will be installed prior to launch. See Figure 2.5.4.4.1-2


88898	A	7345-9012		
SCALE	1	DO NOT SCALE PRINT	SHEET	2-38

Figure 2.5.4.3.2-1 ULEIS Power relay Interfaces

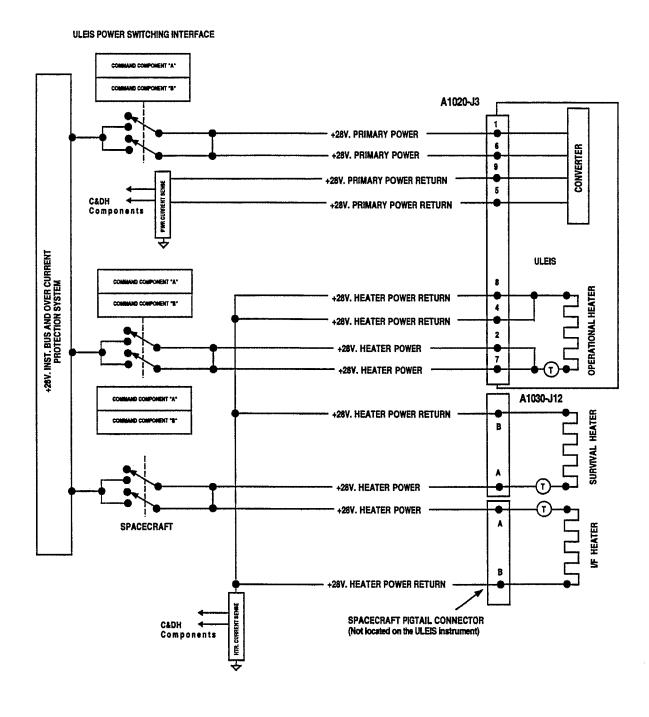

FSCM NO.	SIZE	DWG, NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-39


Figure 2.5.4.4.1-1 Typical Ordnance Fire Control

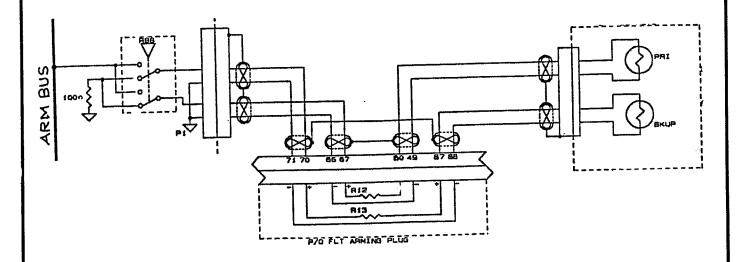


FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9	012	
SCALE		DO NOT SCALE PRINT	SHEET	2-40

Figure 2.5.4.4.1-2 ULEIS Ordnance Fire Interface

ULEIS utilizes the standard S/C ordnance Interface. <u>Both pyros should not be fired simultaneously. There is a primary and secondary pyro. Only the primary pyro should be fired. The secondary will be fired only in the event of failure of the primary pyro.</u>

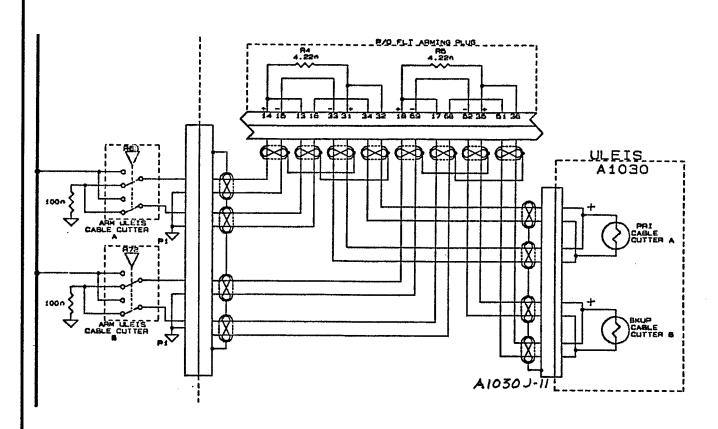

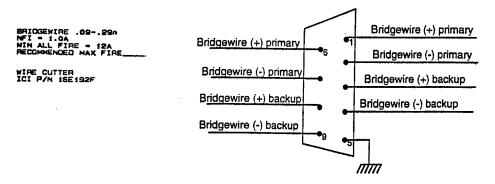

A1030-J11 311P409-1P-8-15
Pyro connector on UMd Telescope Box

FSCM NO.	SIZE	DWG, NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-41

#### 2.5.4.4.1.4 Pyrotechnic Circuit Shields

The pyrotechnic firing circuit within each instrument/sensor shall be continuously shielded from the ordnance device to the interface connector. The shields shall not be used as intentional current-carrying conductors. The shields shall be grounded to the structure at multiple points.

#### 2.5.4.5 Remote Relay Command

Remote Relay commands provide a pulsed +28 V signal or a pulsed ground signal used for switching relays in instrument packages. The pulse can have a selectable duration of 20, 40, 60, or 80 milliseconds. The remote relay command is implemented with non-latching relays in the spacecraft power switching component. The exact interface and configuration of the remote relay command, if required, is documented in Figure 2.5.4.5-1.

#### 2.6 SPACECRAFT C&DH SUBSYSTEM - DATA HANDLING PORTION

Each C&DH Component includes data handling functions. Each C&DH Component collects digital science and housekeeping data, collects and digitizes analog data, and forms a composite serial data stream made up of minor and major frames. A major frame is 16 seconds long and consists of 16 minor frames. Each minor frame makes up the data field of a CCSDS compatible packet, and each packet makes up the data field of a Virtual Channel Data Unit (VCDU), which is the format to be compatible with NASA's ground data system.

Each C&DH Component can connect to instruments with several types of standard telemetry interfaces. These interfaces are serial digital (for science, housekeeping, and memory dump); digital telltale; 0 to +5 V Analog single ended; 0-50 mV differential; and temperature sensor. The instruments need to replicate each telemetry interface that it uses to each C&DH Component.

## 2.6.1 <u>Data Handling Component Interfaces</u>

The number of each interface type that can be provided to each instrument is limited, and must be negotiated.

## 2.6.1.1 Serial Digital - Science, Housekeeping, and Memory Dump

#### **2.6.1.1.1 Description**

A serial digital interface is used to collect a fixed amount of serial digital data at a periodic interval from each instrument. Data collection will occur in exactly the same spot and will be the same length in any minor frame. Each C&DH component can limit check telemetry data, and execute a command if an out-of-limit condition is detected. The instrument data can be limit checked by a C&DH Component only if the data is in a fixed location in the spacecraft minor frame. Each instrument has been allocated a single serial digital interface per C&DH component.

88898	A	DWG. NO. 7345-90	12	
SCALE		DO NOT SCALE PRINT	SHEET	2-42

Figure 2.5.4.5-1 ULEIS Remote Relay Command Interface

ULEIS does not utililize the remote relay command interface

 FSCM NO.
 SIZE
 DWG. NO.

 88898
 A
 7345-9012

 SCALE
 DO NOT SCALE PRINT
 SHEET
 2-43

Instruments will not be provided with a separate interface for memory dumps. If an instrument needs to dump memory contents, it should replace its normal allocation of science data with dump data. Typically, a command to the instrument would place it in the dump mode for a fixed number of major frames. Science and dump data should be formatted so that the ground decommutation process can detect which type of data is present. Typically, data is output most significant bit first.

Figure 2.6.1.1.1-1 shows the bit allocation for each payload instrument/sensor, and the SSS DPU.

#### 2.6.1.1.2 Interface

Each C&DH Component provides each instrument with the following signals:

- a) Minor Frame Pulse an active high pulse at the start of every minor frame
- b) Major Frame Pulse an active high pulse at the start of every major frame, also called 1xMajor Frame Pulse
- c) Clock a continuous clock at 10,956 Hertz. Exactly 10,956 clock pulses will be generated between minor frame pulses.
- d) Read Out Gate (ROG) an active high envelope indicating when instruments should output serial data in response to the Clock

In addition, each C&DH Component will provide the following signals <u>only</u> to those instruments that need them:

- a) 2xMajor Frame Pulse an active high pulse at the start of every other major frame.
- b) 4xMajor Frame Pulse an active high pulse at the start of every fourth major frame.
- 8xMajor Frame Pulse an active high pulse at the start of every eighth major frame.

In response to these signals, the instrument will output serial data over the Data line with the falling edge of the Clock signal. The first circuit interface is shown in Figure 2.6.1.1.2-1. The instrument specific interface is shown in figure 2.6.1.1.2-2. This interface must be duplicated to each C&DH Component. (The instrument must generate a DH select bit in order to select one of the interfaces. Typically an instrument would use a data command to generate the select bit to select the active side.) Instruments shall provide information on the method used to select the active data interface. This data is provided in Figure 2.6.1.1.2-3. The components used to implement the interface to each C&DH shall be physically distinct and separate; no single component shall serve both redundant interfaces. Interface timing is shown in Figure 2.6.1.1.2-3.

FSCM NO. 88898	A	DWG. NO. 7345-90	012	
SCALE		DO NOT SCALE PRINT	SHEET	2-44

Figure 2.6.1.1-1 Downlink Bit Allocation for Each Payload Instrument/Sensor


## Payload Serial Digital Channel Allocations Per Minor Frame

Instrument	Science Format bits(1)	RTSW Format	Total bits Read out by C&DH
CRIS	464		464 .
SIS	1992		1992
ULEIS	1000		1000
EPAM	168	- 168	168 <sup>-</sup>
MAG	304	48	· 304
SWEPAM Ion	544	168	712
SWEPAM Electron	456		456
S³DPU	1624		1624
TOTAL	6552	384	6552

<sup>(1)</sup> Instrument bit stream includes instrument housekeeping and science data.

FSCM NO.	SIZE	DWG. NO.	•	
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-45

Figure 2.6.1.1.2-1 Serial Digital Interface

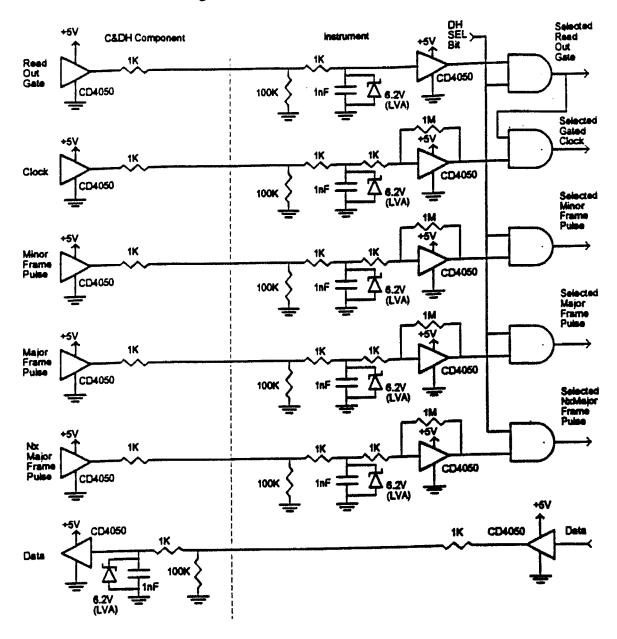

#### Notes:

1. An instrument may not require all types of frame pulses

2. 2x and 8x Major Frame Pulses are available


3. The DH Select Bit is generated in an instrument from a Data or Logic Pulse Command and used to select one of two redundant spacecraft Serial Digital Telemetry, Sun Pulse, and Spin Clock interfaces to use.

4. The AND gates are shown to indicate that the equivalent data handling signals from each C&DH component should not be simply logically ORed together, but rather should be actively selected with the DH Select Bit.

5. An instrument may add a 1Meg ohm feedback resistor to the ROG interface if the ROG signal is used for more than gating the clock signal.

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9	9012	
SCALE		DO NOT SCALE PRINT	SHEET	2-46

Figure 2.6.1.1.2-2 ULEIS Science, Housekeeping, and Memory Dump Digital Interface

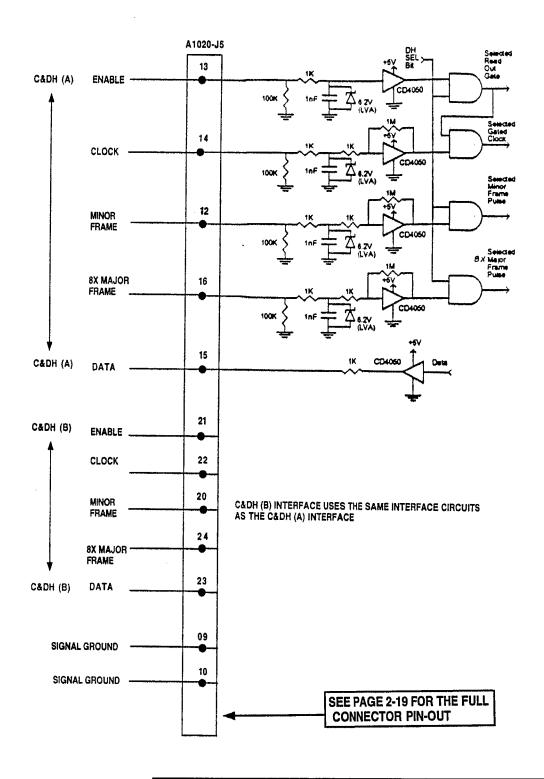


88898	A	DWG, NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-47

## Figure 2.6.1.1.2-3 ULEIS Method Used to Select Active Data Channel

The ULEIS IDT accepts the responsibility for the proper selection of the active data channel.

Figure 2.6.1.1.2-3 Serial Digital Interface Timing

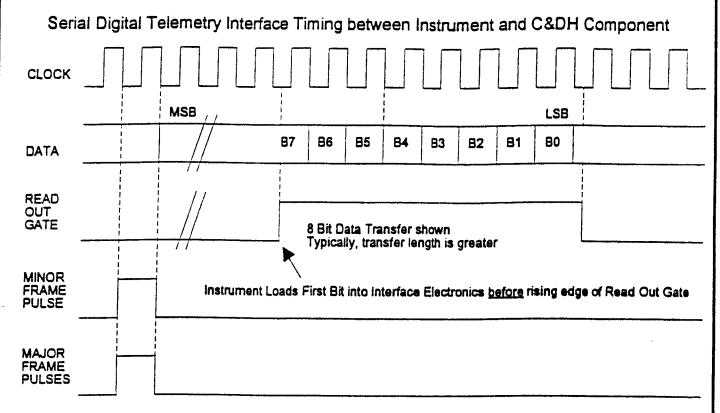

#### Notes:

- Instrument initiates load of first bit before rising edge of Read Out Gate (after Minor Frame Pulse).
   After first data bit, instrument loads next data bit on falling edge of clock, C&DH Component reads on rising edge of clock. The data must be stable 1/4 bit time before the rising edge of the clock signal.
- 3. Major frame pulses (1x, 2X, and 8x) not present every minor frame
- 4. Low = logic 0 = Ground; High = logic 1 = 5V
   5. Minor and Major Frame Pulses may be delayed from the clock edges by up to 5 microseconds

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-49

#### 2.6.1.2 Digital Telltales

#### **2.6.1.2.1 Description**

The digital telltale interface will be used to sample the state of a two state device (such as a switch) in an instrument. It is only appropriate to use a digital telltale interface if the state of the device must be sampled when the instrument is turned off (otherwise the instrument could embed the telltale in its serial telemetry stream).

#### 2.6.1.2.2 Interface

Two types of digital telltale interfaces are available. If +5V is available in the device to be sampled, the telltale can be buffered with a CD4050 device. If the telltale is derived from a switch, and +5V is not available to establish two levels, the switch should connect to signal ground in one state and be open in the other state. The two interfaces are shown in Figure 2.6.1.2.2.-1. The instrument specific interface is shown in Figure 2.6.1.2.2-2.

## 2.6.1.3 0-5V Single Ended Analog Interface

#### **2.6.1.3.1 Description**

The interface is used to sample and digitize voltages which have been conditioned to be within a 0 to 5V range. Note that if the output of a +5V DC-DC converter is to be sampled, the telemetry point should be a restively divided version of the converter output so that a converter output over-voltage can be sensed. Subcommutated interfaces will be supported but must be synchronized to the 2x or the 8x major frame pulse. Note: users should not assume that the least significant bit is free from noise.

#### 2.6.1.3.2 Interface

The first circuit interface is shown in Figure 2.6.1.3.2-1. Note: The op amp used to buffer the single-ended voltage should be capable of maintaining its output voltage if the output to one C&DH component is grounded. Power supply voltages can use two resistive dividers instead of an op amp. The instrument specific interface is shown in Figure 2.6.1.3.2-2.


## 2.6.1.4 0 to +50mV Differential Analog Interface

## 2.6.1.4.1 Description

The interface is typically used to sample the voltage across a current sensing resistor.

FSCM NO. 88898	A	DWG, NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-50

Figure 2.6.1.2.2-1 Digital Telltale Interface

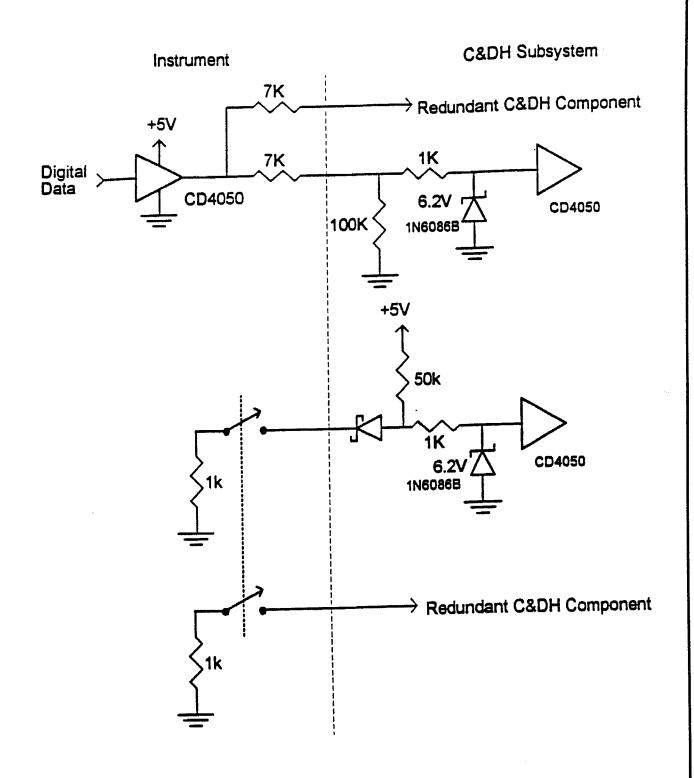


88898	A	7345-9012			
SCALE		DO NOT SCALE PRINT	SHEET	2-51	

## Figure 2.6.1.2.2-2 ULEIS Digital Telltale Interface

The ULEIS instrument does not utilize the digital telltale interface.

FSCM NO.	SIZE	DWG. NO.			
88898	Α	7			
SCALE		DO NOT SCALE PRIN	VТ	SHEET	2-52

Figure 2.6.1.3.2-1 Single Ended Analog 0-5V Interface

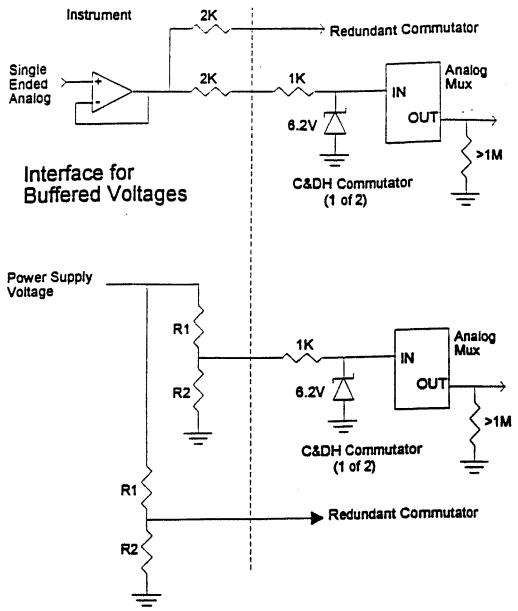


R1, R2 chosen so that max voltage out is 5.0V. The parallel resistance of R1 and R2 should be less than 4K ohms for a conversion error of 1 lsb; larger resistors are acceptable if the user can tolerate a larger error

# Interface for Power Supply Voltages

88898	A	DWG. NO. 7345-9	012	
SCALE		DO NOT SCALE PRINT	SHEET	2-53

Figure 2.6.1.3.2-2 ULEIS Single Ended Analog 0-5V Interface

ULEIS has 1 (one) redundant 0-5V single ended analog voltage interfaces. This interface conforms exactly to the standard GIIS interface. This is used to sense the 5 volt DPU power supply line.

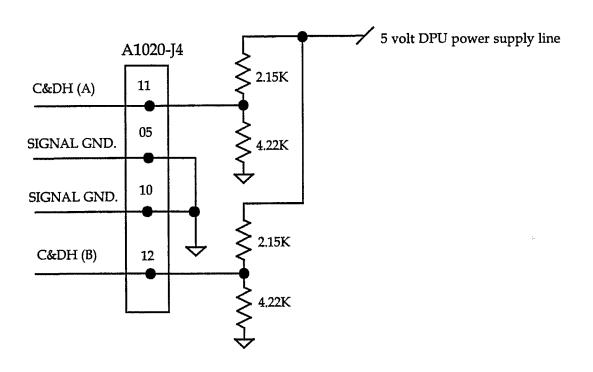

88898	A	DWG. NO. 7345-90		
SCALE		DO NOT SCALE PRINT	SHEET	2-54

#### **2.6.1.4.2** Interface

The first circuit interface is shown in Figure 2.6.1.4.2-1. The instrument specific interface is shown in Figure 2.6.1.4.2-2.

### **2.6.1.5** Temperature Sensor Interfaces

### **2.6.1.5.1** Description

Two temperature sensors are available for new instrument/sensor designs. The AD590 is for use over the range of -60 to +100 $^{\circ}$  C. It is a packaged in a 2 lead flatpack. The PT-103 is for use of the range of -100 to +150 $^{\circ}$  C. It is a platinum wire sensor. Existing instrument/sensor designs using spacecraft powered will be treated in detail in their respective SIIS.

#### **2.6.1.5.2** Interface

The first circuit interfaces are shown in Figure 2.6.1.5.2-1. Note that a separate temperature sensor is required to interface to each C&DH Component. The instrument specific interface is shown in Figure 2.6.1.5.2-2.

### 2.6.1.6 Sun Pulse and Spin Clock

### **2.6.1.6.1 Description**

Each C&DH component is connected to a two axis Sun Sensor. Each Sun Sensor outputs an 8 bit X Sun Angle and an 8 bit Y Sun Angle. The C&DH Component generates a Sun Pulse based on the rising edge of the msb of the X-Axis Sun Sensor Angle. The Sun Pulse will be 732+/-TBD μs long. The C&DH Component will distribute the Sun Pulse to those instruments that require them. Each C&DH Component will also generate and distribute a Spin Clock. The Spin Clock will contain 16384+/-10 (TBR) pulses between each rising edge of the Sun Pulse. The +/-10 (TBR) error includes all normal perturbations of the Sun Pulse, and not just error in the generation of the Spin Clock. A timing diagram of the Sun Pulse and Spin Clock is shown in Figure 2.6.1.6.1-1.


The instrument should use the same Data Handling Select Bit used to select the active Serial Digital Telemetry interface to select the active Sun Pulse and Spin Clock interface. Typically, an instrument would use a Data Command to generate the select bit and select the active side. Note: users need to "remember" which side of the C&DH interface to use after resets.

#### **2.6.1.6.2** Interface

Each C&DH Component will provide each instrument with a Sun Pulse interface and a Spin Clock interface. The first circuit interface is shown in Figure 2.6.1.6.2-1. The components used to implement the interface to each C&DH Component shall be physically distinct and separate; no single component shall serve both redundant interfaces. The instrument specific sun pulse interface is shown in Figure 2.6.1.6.2-2.

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-55

Figure 2.6.1.4.2-1 Differential Analog Interface

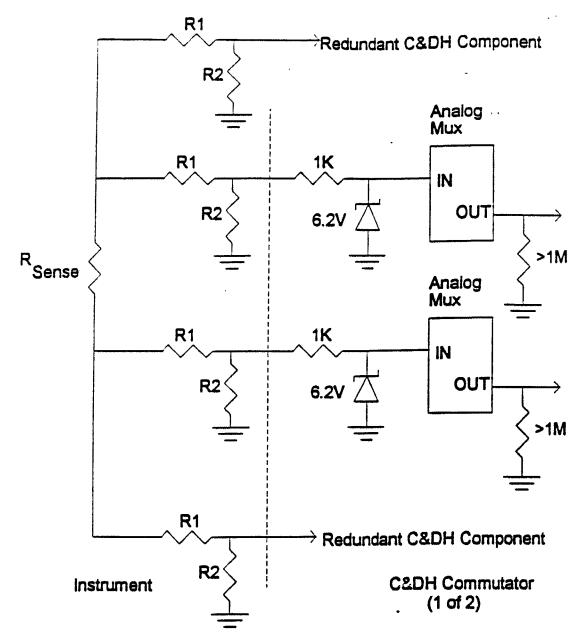


# Differential Analog Voltage Interface

Note: The parallel resistance of R1 and R2 should be less than 4K ohms. For most applications R1 and R2 will not be needed (for measuring current in a primary power current return line).

FSCM NO.	SIZE			
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-56


Figure 2.6.1.4.2-2 ULEIS Differential Analog Interface

ULEIS has current sensing resistors on both the primary power and heater return lines. These differential interfaces are in the spacecraft power handling system and not in the instrument. ULEIS also has one redundant 50mV differential interface inside of the instrument. It is used to sense current in the Analog Electronics LVPS .This interfaces is shown below.

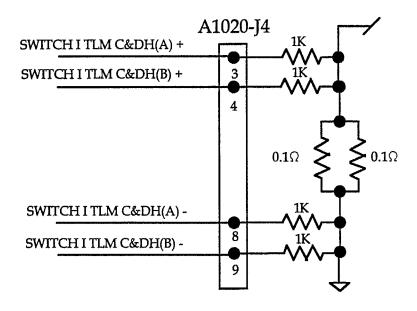

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-57


Figure 2.6.1.5.2-1 Temperature Sensor Interfaces

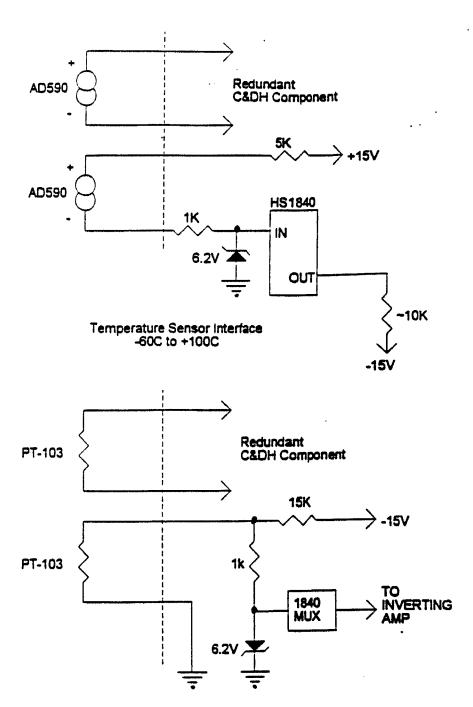

Temperature Sensor Interface -100C to +150C


<b>88898</b>	A	DWG. NO. 7345	9012	
SCALE		DO NOT SCALE PRINT	SHEET	2-58

Figure 2.6.1.5.2-2 ULEIS Temperature Sensor Interfaces

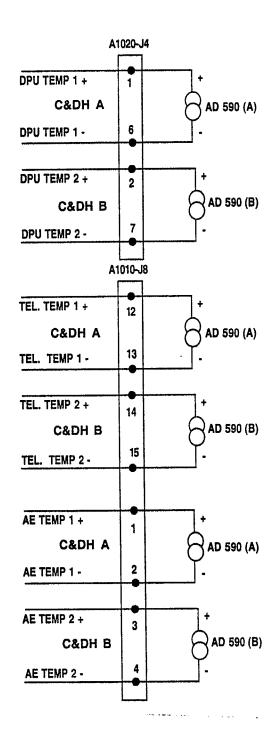

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-59


Figure 2.6.1.6.1-1 Sun Pulse/Spin Clock Interface Timing

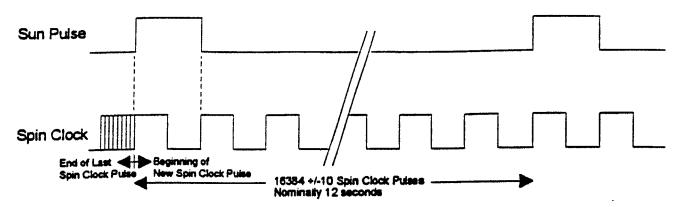


#### Notes:

Spin Clock duty cycyle 40/60 or better
 Spin Clock pulse in progress when a Sun Pulse occurs will be terminated by the Sun Pulse and a new spin clock pulse started. The spin clock signal may or may not go have a rising edge when the new spin clock pulse is started. If the signal is already low, it will go high. If the signal is already high, it will stay high.

FSCM NO. 88898	A	DWG, NO.	7345-9012	
SCALE		DO NOT SCALE PRINT	SHEE	ET 2-60

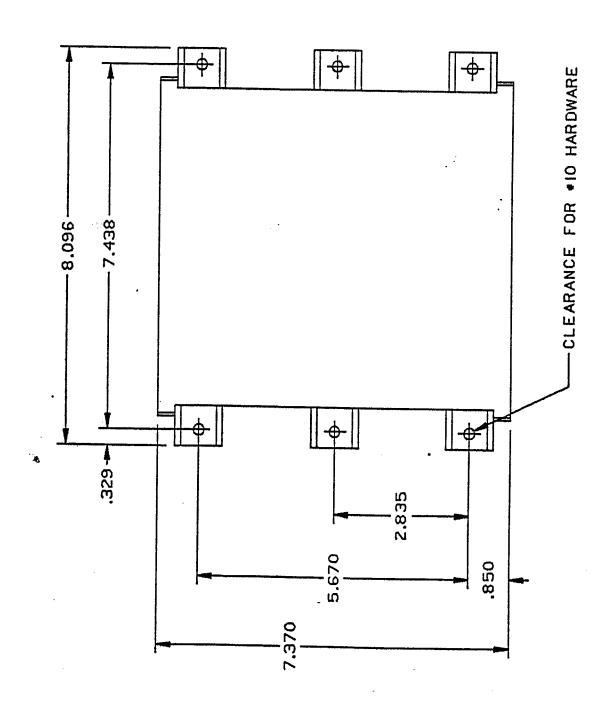

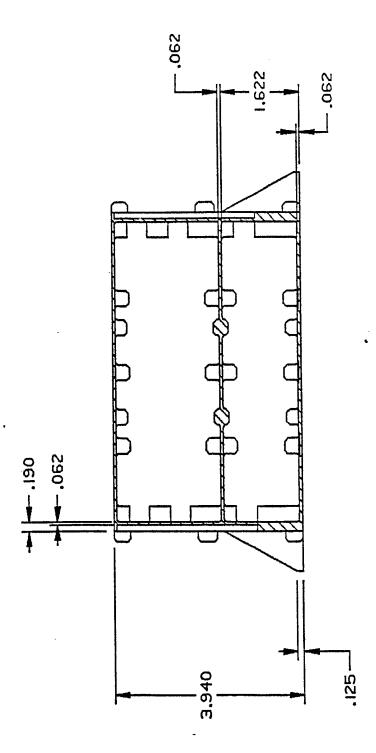

1


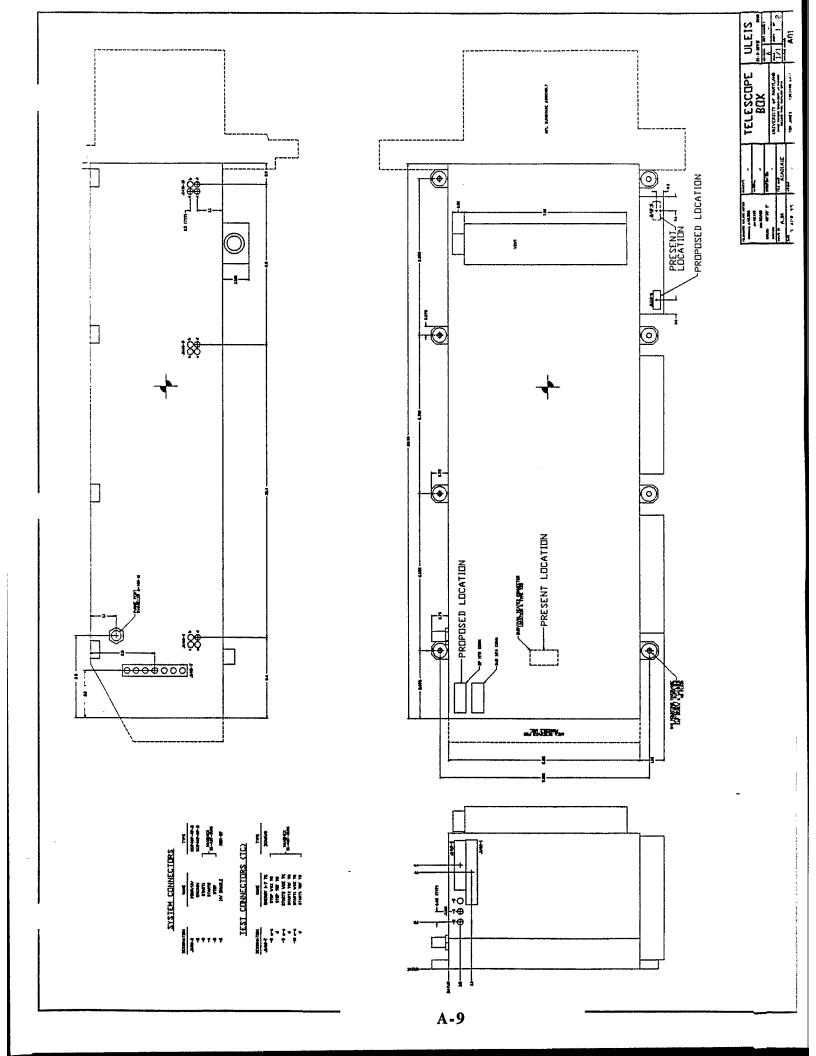


Figure 2.6.1.6.2-1 Sun Pulse/Spin Clock Interface

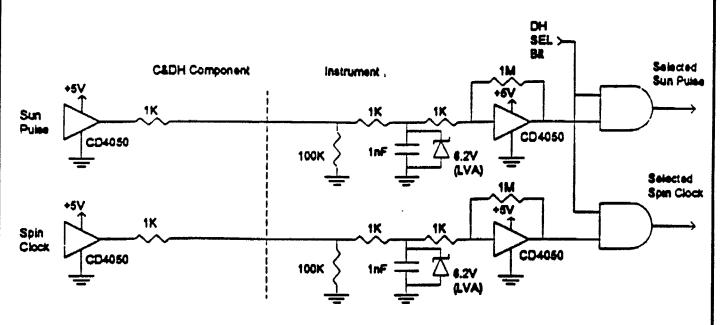


#### Mates.

1. Interface shown for a single C&DH Component - repeated for other C&DH Component

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-61

Figure 2.6.1.6.2-2 ULEIS Sun Pulse/Spin Clock Interface

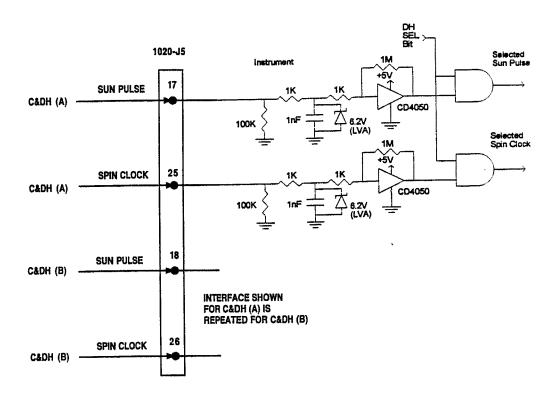

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	2-62

#### 2.6.1.6.3 Sun Sensor Failure

If the Sun Sensor connected to the active Data Handling Component fails, the C&DH Component will no longer transmit a valid Sun Pulse and/or Spin Clock. The lack of a valid Sun Pulse will <u>not</u> be detected in a C&DH Component; a simulated Sun Pulse will <u>not</u> be generated and distributed. Sun Sensor failure would not be detected until the next ground pass (up to approximately 48 hours). At that time, the primary C&DH Component and Sun Sensor would be turned off, and the backup C&DH Component and Sun Sensor would be turned on.

### 2.7 PAYLOAD INSTRUMENT/SENSOR SYNCHRONIZATION SIGNALS

#### 2.7.1 General


The spacecraft will supply sync. signals to the instruments/sensors which are related to the basic digital data rates, or are related to spacecraft generated attitude data. The characteristics of these sync. signals and the first circuit interfaces shall be documented in the SIIS's.

### 2.7.1.1 Available Synchronization Signals

The following synchronization signals are available from the spacecraft:

- a) Major Frame Pulse (an active high pulse at the start of every major frame)
- b) 2xMajor Frame Pulse (an active high pulse at the start of every 2 major frames)
- c) 8xMajor Frame Pulse (an active high pulse at the start of every 8 major frames).
- d) Minor Frame Pulse (an active high pulse at the start of every minor frame)
- e) Sun Pulse
- f) Spin Clock

88898 A	7345-9012		
FSCM NO. SIZE	DWG. NO.		

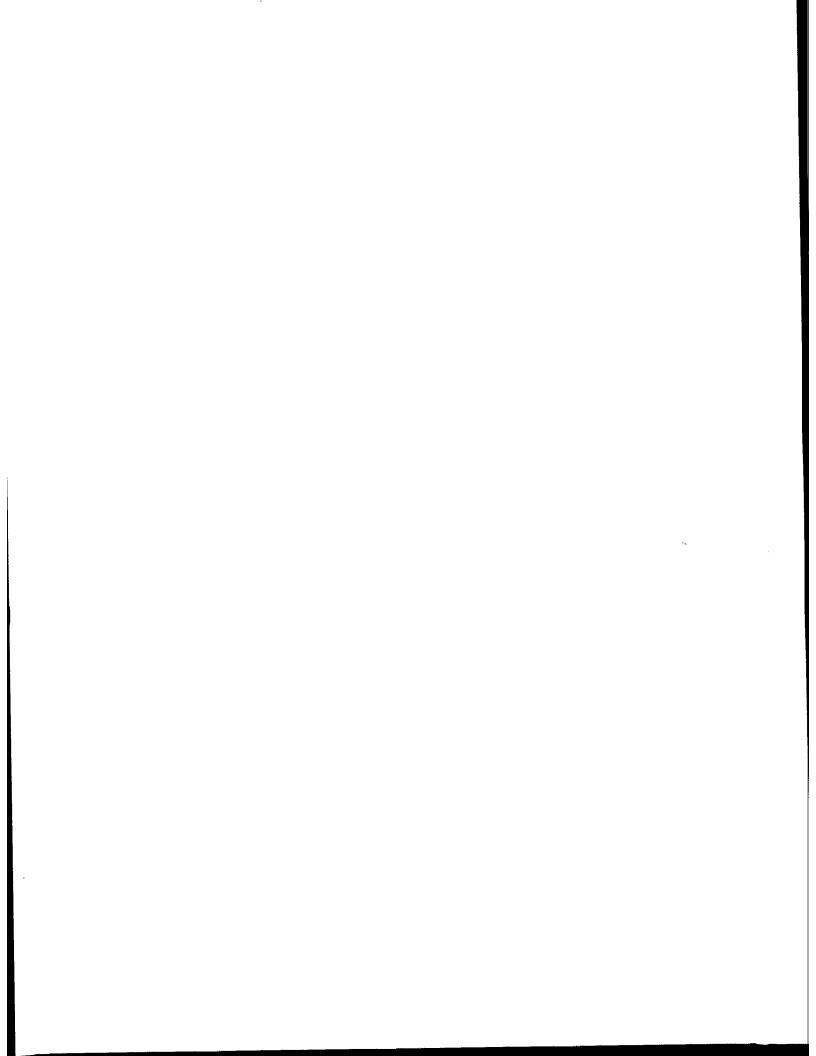

### 3.0 <u>MECHANICAL INTERFACE REQUIREMENTS</u>

This section describes the mechanical interfaces between the payload instruments and the spacecraft. These interfaces include the envelopes, mounting mass, products of inertia, and other mechanical forces which may be transmitted from the payload instrument to the spacecraft. The mechanical environment to which the Observatory will be tested (sine and random vibration, acoustic and shock) and recommended levels for instrument/sensor level testing are given in the ACE Environmental Specification APL 7345-9007.

### 3.1 INSTRUMENT PHYSICAL CHARACTERISTICS

#### 3.1.1 <u>Mass</u>

The payload instrument/sensor mass including grounding straps, bolts, brackets, etc., shall be established and recorded in the Specific Instrument Interface Specification. Flight hardware shall be weighed, and the mass of each instrument/sensor assembly shall be documented to an accuracy of 1% or 1 pound, whichever is less. If the orbital configuration differs from the launch configuration (i.e., deployable covers, etc.), the mass in each configuration shall be specified. Note: Mass estimates are shown in Figure 3.1.3-1. Please consult Caltech Table 3.2-1, Science Payload Mass Estimates

### 3.1.2 Size

Payload instrument/sensor size and envelope shall be established by the experimenter and documented in each of the Specific Instrument Interface Documents, including volume required for deploying sensor protective covers.

### 3.1.3 Center of Mass

Payload instrument/sensor center of mass shall be established to an accuracy of  $\pm$  10% and documented in Figure 3.1.3-1 and/or on the mechanical ICD drawing. Any deviation in center of mass due to deployment of protective covers shall defined and documented in the Figure 3.1.3-2

### 3.1.4 Moments of Inertia

The accuracy of payload instrument/sensor moments of inertia calculations shall have a goal of  $\pm$  10% and documented in each of the Specific Instrument Interface Documents.

### 3.1.5 <u>Mechanical Interface Drawings</u>

Each payload instrument/sensor experimenter shall supply the following applicable Interface Control Drawings, Procedures, and Tables for inclusion in the Specific Instrument Interface Documents. Note: S/C shall provide general drawing of instrument locations in the SIIS. All dimensions and notes shall be in English units of measure.

- a) Envelope drawing (Cover Stowed, Transition, Open)
- b) Center of Mass Location/Moments of Inertia

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-90	012	
SCALE		DO NOT SCALE PRINT	SHEET	3-1

Figure 3.1.3-1 ULEIS Mass and Center of Mass

Note: Mass estimates shown in this figure are current as of the ULEIS CDR. Instrument mass is now under configuration control. Please consult Caltech Table 3.2-1, "Science Payload Mass Estimates" for up-dated mass estimates.

Telescope	11.1kg
DPU	2.4kg.
Analog Box	3.2kg.
Intra-instrument Harness	0.71kg.
Bracket*	2.26kg.

<sup>\*</sup> Bracket mass charged to the S/C mass budget.

Center of mass of the ULEIS components is shown on the interface drawings contained in Appendix A.

Note: The interface drawing mentioned above is TBD. The due date for the interface drawing is 1 August 1995.

88898	A	DWG. NO. 734:	5-9012		
SCALE		DO NOT SCALE PRINT		SHEET	3-2

Figure 3.1.3-2 Instrument Center of Mass Change Due to Cover Actuation

The change in the instrument center of mass due to cover actuation is negligible.

### SCALE | DO NOT SCALE PRINT | SHEET | 3-3

- c) Field-of View Drawing
- d) Alignment reference marks
- e) Mass
- f) Adjustments
- g) Full Sized Mechanical Interface Drawing
- h) Mounting Interface Preparation
- i) Mounting Hardware and Torque Specifications
- j) Connector Locations
- k) Connector Identification
- l) Red and Green Tag Items
- m) Test Connectors and Locations
- n) Special Grounding Provisions
- o) Access Requirements
- p) Handling Fixtures Interfaces and Lift Point Locations
- q) Heat Pipe Locations
- r) Location of Purge Connector
- s) Location of Pyro Actuators
- t) Critical Harness Routing/Requirements (u) Thermal/Optical Properties of Instrument Exterior Surfaces.

Specifc instrument mechanical interface drawings are located in Appendix A.

### 3.2 INSTRUMENT MOUNTING

### 3.2.1 General

Payload instruments/sensors shall be designed for installation and removal from the ACE spacecraft without disassembly of the instrument/sensor. Instruments/sensors shall be mounted to the spacecraft by means of mounting hardware passing through flanges located on the payload instruments/sensors. Mounting hardware shall be accessible from the top of each

ł	FSCM NO.	SIZE	DWG. NO.		
	88898	Α	7345-9012		
	SCALE		DO NOT SCALE PRINT	SHEET	3-4

instrument/sensor. Special mounting hardware if required, shall be provided by the instrument/sensor experimenter.

### 3.2.2 <u>Instrument Mounting Flange Specifications</u>

Instrument mounting hole size, mounting bolt size, mounting bolt torque, mounting hole configuration, position tolerance, and mount flange planarity shall be detailed in Figure 3.2.2-1 The spacecraft shall supply standard ANSI mounting hardware only. Note: Minimum mounting plane flatness shall be 0.015" over the longest dimension. Minimum flatness shall be verified prior to integration.

### 3.2.3 <u>Instrument Mounting Hardware Specification</u>

Mounting bolt size and quantity for each sensor shall be determined in accordance with standard practice. Mounting bolt threads shall be American Unified SAE Threads per ANSI 81.1 - 1982. Thread tolerance shall be class 2A/2B.

### 3.2.4 <u>Mounting Hole Location Tolerance</u>

Mounting hole locations shall have positional tolerances which do not exceed 0.014 inches diametrical clearance at maximum material condition. Mounting bolt hole clearance diameters shall not exceed +0.005/-0.001.

### 3.2.5 <u>Instrument Mounting Repeatability</u>

All instruments which must be removed and replaced after optical axis alignment shall provide means of preserving alignment on repeated mountings. The method of preserving alignment shall be documented in Figure 3.2.5-1. This requirement applies to critically aligned instruments only.

### 3.3 ALIGNMENT

Alignment of the payload instrument/sensor optical Axes shall be accomplished by control of the instrument/spacecraft mounting interface. Specific alignment requirements shall be documented in Figure 3.2.2-1.

The shift of the optical axes location with respect to the spacecraft axes, when exposed to the environment outlined in the ACE Environments Specification APL 7345-9007, shall not be greater than that defined in the Specific Instrument Interface Specification for each payload instrument.

### 3.3.1 <u>Definition of Spacecraft Axes</u>

The spacecraft axes are defined in Figure 3.3-1.

### 3.3.2 <u>Definition of Instrument/Sensor Optical Axes</u>

The instrument/sensor optical axes are defined by the use of Figure 3.3-2.

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-90	012	
SCALE		DO NOT SCALE PRINT	SHEET	3-5

Figure 3.2.2-1 ULEIS Mounting Specification



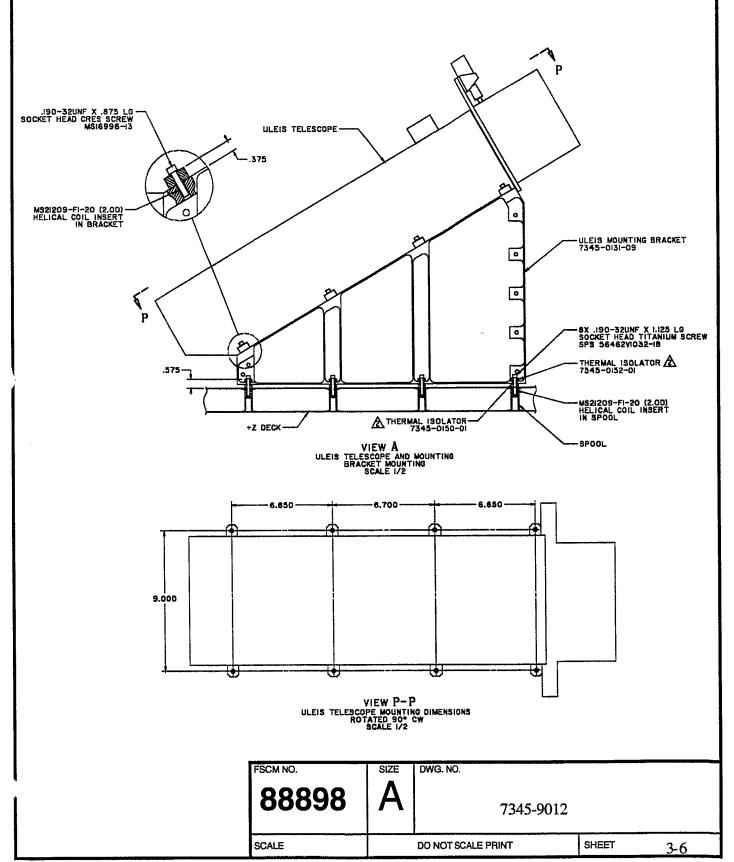


Figure 3.2.2-1 ULEIS Mounting Specification (Cont.)

# FOR TORQUE SPECIFICATIONS SEE S.P. NO. APL 1502

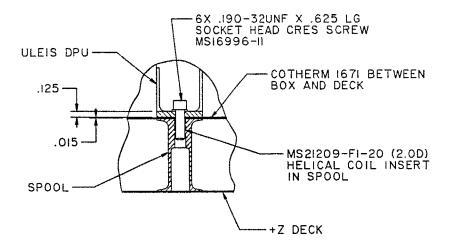

ULEIS DPU MOUNTING

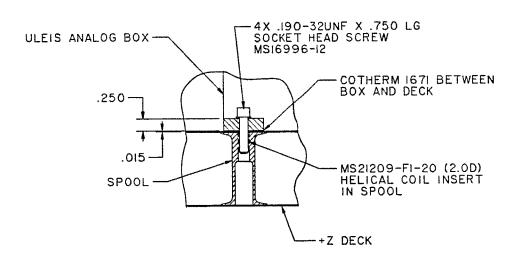

ULEIS ANALOG BOX MOUNTING

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT		3-6 A

### Figure 3.2.5-1 ULEIS Instrument Mounting Repeatability


The normal mounting tolerances are sufficient to provide enough position repeatability for ULEIS.

 88898
 A
 DWG. NO.

 7345-9012

 SCALE
 DO NOT SCALE PRINT
 SHEET
 3-7


Figure 3.3-1 Definition of Spacecraft Axes

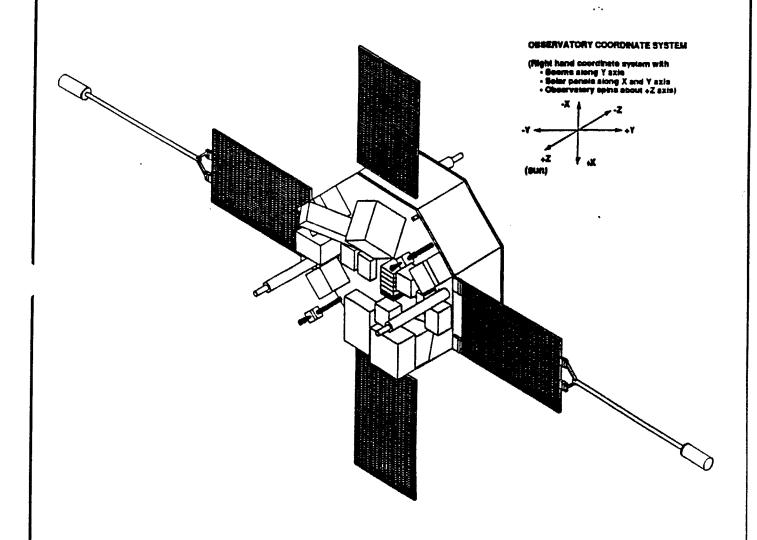

888	98	A	DWG, NO.	7345-9	0012	
SCALE			DO NOT SCAL	E PRINT	SHEET	3-8

### Figure 3.3-2 Definition of ULEIS Optical Axes

ULEIS requires a completely clear primary Field of View (FOV) for the front detector aperture on the instrument. Secondary FOV's should be free of highly reflective materials, in order to avoid glint and particles entering the telescope via reflection.

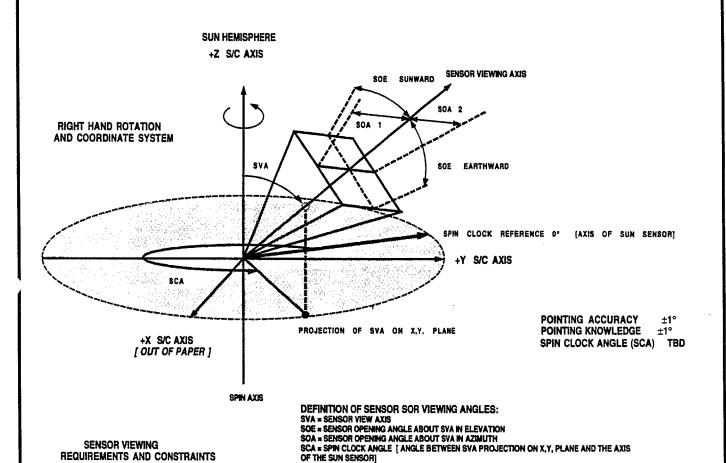

#### PRIMARY FIELD OF VIEW (OBSTRUCTION FREE)

SENSOR	SVA	SOE Sunward	SOE EARTHWARD	SOA 1	SOA 2
TELESCOPE	60°	10°	10°	12°	1 <b>2</b> °

#### SECONDARY FIELD OF VIEW

SOE SUNWARD	SOE EARTHWARD	SOA 1	SOA 2
45°	45°	45°	45°

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9012		
SCALE	DO NOT SCALE PRINT		SHEET	3-9

### 3.3.3 Alignment of Optical Axis

The alignment of the instrument/sensor optical axes shall be accomplished by positioning the mounting hole locations, on the spacecraft, with respect to the spacecraft coordinate system. The optical axes of the instrument/sensor shall be related to the instrument/sensor mounting hole pattern. The instrument/sensor experimenter shall measure the optical axis alignment with respect to the mounting hole pattern to verify the validity of the optical axis alignment.

#### 3.4 HARNESS TIE POINTS

Harness tie points, if needed. on an instrument/sensor shall consist of individual cable clamps attached to the instrument/sensor, or lacing clips bonded with epoxy adhesive.

Payload instruments/sensors shall provide suitable cable clamp tie points or areas free from surface coatings suitable for the application of epoxy adhesive. The tie points or bonding areas are shown in Figure 3.4-1 or on the mechanical drawings. The spacecraft shall provide a general harness drawing.

### 3.5 PAYLOAD INSTRUMENT/SENSOR LOAD DESIGN

#### 3.5.1 General

The payload instruments/sensors shall be designed to provide primary load paths from the sensor masses to the sensor mounting flange in the most direct path practical.

### 3.5.2 <u>Load Directions</u>

Payload instruments/sensors shall be designed to withstand static and dynamic loads in any direction as specified in the ACE Environments Specification; APL 7345-9007. Payload instruments/sensors shall be designed to the stiffness described in APL 7345-9007.

#### 3.6 PAYLOAD INSTRUMENT/SENSOR PROTECTIVE COVERS

#### 3.6.1 Non-Flight Protective Covers

Protective covers shall be provided, if necessary, with each payload instrument/sensor to preclude damage caused by the entrance of foreign particles to sensitive areas and the rigors of handling, spacecraft integration and bench testing. Protective Covers shall be easily accessible and removable at the launch site. All protective covers shall be color coded and labeled "NON-FLIGHT" or shall be red-tagged. Covers for all interface connectors shall also be provided.

#### 3.6.2 Flight Covers and Doors

The deployment of flight covers and doors shall not cause disturbance to other instruments on the spacecraft by blocking radiators, solar panels or the field-of-view of other instruments. All sensor covers, their operational description, and their deployment envelope shall be described and documented in this document and in Figure 3.6.2-1.

88898	A	DWG. NO. 7345-9	012	
SCALE		DO NOT SCALE PRINT	SHEET	3-10

## Figure 3.4-1 Location of ULEIS S/C Harness Tie Points

The S/C harness tie points are shown on the interface drawing in Appendix A.

Note: The interface drawing mentioned above is TBD. The due date for the interface drawing is 1 August 1995.

88898	A	DWG. NO. 7345-901	2	
SCALE		DO NOT SCALE PRINT	SHEET	3-11

### Figure 3.6.2-1 ULEIS Sensor Cover Data

ULEIS has a deployable cover. The cover is deployed by the firing of pyrotechnic devices. The cover remains deployed during the vast majority of the mission, but is occasionally partially closed by a stepper motor during periods of high solar activity. The cover is nearly completely closed during calibration runs which occur approximately once a month. The deployment envelope for this covers is shown in a drawing in Appendix A.

Note: The interface drawing mentioned above is TBD. The due date for the interface drawing is 1 August 1995.

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	3-12

# 3.7 PAYLOAD INSTRUMENT/SENSOR UNIQUE TOOLING AND HANDLING FIXTURES

### 3.7.1 Optical Tooling

Instruments/sensors which require unique optical equipment to define operational alignment shall provide the needed equipment prior to spacecraft integration. Equipment descriptions, designations, and alignment procedures shall be documented in the Figure 3.7.1-1.

### 3.7.2 Handling Fixtures

Handling fixtures shall be provided, for all instrument/sensors, by the instrument/sensor experimenter for all equipment which exceed 35 lbs. The handling fixtures shall be used to remove the instrument/sensor from the shipping container and for the installation of the instrument/sensor aboard the spacecraft. Note: The handling fixture shall be proof tested to 2.5x the rated load The period of certification shall be 1 year.

### 3.8 PAYLOAD INSTRUMENT/SENSOR ACCESSIBILITY

All instrument/sensor experimenters shall identify the times, in the integration test flow, when access to their flight hardware is required. The type of access, duration, test equipment required and procedures shall be documented in Figure 3.8-1. After integration instruments shall not be removed except to repair faults or to accomplish prearranged (approved) calibration procedures.

NOTE: At some point (TBD) in the spacecraft integration, access to individual instruments/ sensors may be prohibitively time consuming and/or expensive. Instruments shall provide information concerning access holes needed in thermal blankets.

### 3.9 PAYLOAD INSTRUMENT/SENSOR IDENTIFICATION AND MARKING

All flight hardware and shall be marked with appropriate (AXXXX) identification. The markings shall be permanent, resistant to chipping and located away from points of physical wear. Interface connectors, test points and adjustments shall be clearly labeled. (AXXXX-JXX). These "A" numbers shall be supplied by the spacecraft. A list of instrument identification numbers is found in Figure 3.9-1

### 3.10 PAYLOAD INSTRUMENT/SENSOR MAINTAINABILITY

The maintainability guidelines presented below shall be considered to the extent practical during all design efforts .

- a) Designs should avoid projecting parts which may be easily damaged during handling.
- b) Designs should be configured to stand alone in a stable manner.
- c) All design components which may be inadvertently reversed or misaligned during integration should be keyed.

88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	3-13



N/A for ULEIS

 FSCM NO.
 SIZE
 DWG. NO.

 4
 7345-9012

 SCALE
 DO NOT SCALE PRINT
 SHEET
 3-14

### Figure 3.8-1 ULEIS Access Requirements

The ULEIS telescope has a number of test connectors which must be accessed during Integration and Test. The ULIES DPU has one test connector which must be accessed during I and T.

An interface drawing showing locations of the connectors is included in Appendix A.

Access to the detector covers is required in order to install radiation sources.

ULEIS (less DPU) will require removal from the S/C during Integration and Test for changeout of detectors. This process will take approximately 8 weeks.

Note: The interface drawing mentioned above is TBD. The due date for the interface drawing is 1 August 1995.

FSCM NO. 88898	A	DWG. NO. 7345-90	12	
SCALE		DO NOT SCALE PRINT	SHEET	3-15

Figure 3.9-1 Instrument Identification Numbers

INSTRUMENT	ID NUMBER	SENSOR A (-Y)	SENSOR B (+Y)
EPAM	A1100	· · · · · · · · · · · · · · · · · · ·	
EPAM ADAPTER	A1101		
EPAM BRACKET	A1102		
MAGNETOMETER	A1050	A1430	A1470
ULEIS TELESCOPE	A1030		
ULEIS DPU	A1020		
ULEIS ANALOG	A1010		
SEPICA	A1040		
SWIMS	A0410		
SSSDPU	A1070		
SWICS	A1090		
SWEPAM ION	A1120		
SWEPAM ELECTRON	A1080		
CRIS	A0810		
SIS	A1060		

FSCM NO.	SIZE	DWG, NO.		
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	3-16

c) All design components which may be inadvertently reversed or misaligned during integration should be keyed.

d) Instruments/sensors shall be designed to prevent ESD malfunctions caused by normal space laboratory handling and integration practices.

### 3.11 PAYLOAD INSTRUMENT/SENSOR STORAGE

Instruments/sensors shall be capable of being stored for at least 6 months under conditions of temperature and humidity specified in Figure 3.11-1 without requiring major repair, maintenance or recalibration. Any refurbishment requirements after storage shall be documented in Figure 3.11-2. Note: JHU/APL will supply  $N_2$  and plumbing to the instrument purge connector for all off-line operations, which require purge, and for storage periods resulting from integration delays or other conditions.

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	3-17

### Figure 3.11-1 ULEIS Storage Requirements

The ULEIS Telescope should be returned to its shipping container whenever it is anticipated that it will not be used for an extended period of time. This time should not exceed two months. The container has a dry nitrogen purge vent which should be connected to the spacecraft supplied nitrogen system. The temperature must be maintained below 35 degrees C at all times.


The ULEIS DPU and Analog Electronic packages have no special storage requirements other than those normally associated with flight hardware.

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	3-18

## Figure 3.11-2 ULEIS Refurbishment After Storage

ULEIS does not require any special refurbishment after normal storage. A instrument checkout procedure will need to be performed using the GSE prior to remounting the instrument on the spacecraft

88898	A	DWG. NO. 7345-90	12	
SCALE		DO NOT SCALE PRINT	SHEET	3-19



# 4.0 PAYLOAD INSTRUMENT/SENSOR THERMAL INTERFACE REQUIREMENTS

### 4.1 GENERAL

Note: In keeping with the concept of a combined GIIS and SIIS the general thermal requirements of the GIIS are included in this section. Specific instrument thermal interface requirements are shown in Figures and are referenced to the general GIIS paragraph numbers.

Instrument/sensor thermal dissipation will be removed via conductive transfer to the spacecraft, radiative transfer from the instrument/sensor to its external surroundings, or a combination of both depending upon the nature of the thermal interface. Any instrument requiring radiative coupling to space will be able to greatly simplify its thermal design effort by maintaining an isolated interface with the spacecraft. An isolated interface is strongly urged for most instruments. Boxes with no apertures and requiring no space view may be conductively tied to the spacecraft and covered with MLI.

Thermal control systems aboard the spacecraft will ensure that the deck temperature at each instrument/sensor mounting location remains within the limits specified in the individual SIIS (Specific Instrument Interface Specification). To accomplish this task, the interface characteristic for each instrument must be included in the overall spacecraft thermal model

### 4.2 SPACECRAFT THERMAL DESIGN AND CONTROL

The ACE spacecraft consists of two honeycomb decks tied together by internal supports and honeycomb side panels. The two decks are octagonally shaped with four solar panels extending horizontally from the +X and +Y deck edges, facing the sun hemisphere. The spacecraft is spinning at approximately 5 rpm. The axis of rotation points to within 20 degrees of the sun.


The preliminary spacecraft thermal design environment is illustrated in Figure 4.2-1. The upper deck of the spacecraft is covered by thermal insulation to shield it from the sun as much as possible. Heat is rejected from the +Z forward deck via radiators which are attached to all eight edges of the octagon. The radiators face radially away from the axis of symmetry of the spacecraft. The size of the various radiators will be determined as the thermal design matures.

The spacecraft side panels are used primarily for mounting spacecraft components. However, the +X/-Y and -X/+Y panels have been allocated for the isolated mounting of the SWIMS and CRIS instruments, respectively. The spacecraft thermal design will minimize the heat exchange between individual side panels and space by enclosing all of the panels in thermal insulation blankets that extend from the bottom of the instrument deck radiators to the beginning of the aft deck attach flange. For the instruments mounted on the side panels, the insulation blankets will serve to radiatively isolate the instrument from the side panel. Sun sensor and Star Scanner apertures will not be covered with MLI.

The spacecraft aft deck serves as the mounting platform for the propulsion system. In addition, components of the RF subsystem are mounted to the space-facing side of the aft deck. The observatory attach fitting is bolted to the aft deck and will also be used as a thermal radiator. Thermal blankets will closeout the areas around the exposed antenna dishes.

88898	A	DWG. NO. 7345-9	012	
SCALE		DO NOT SCALE PRINT	SHEET	4-1

Figure 4.2-1 Preliminary Spacecraft Thermal Design Environment

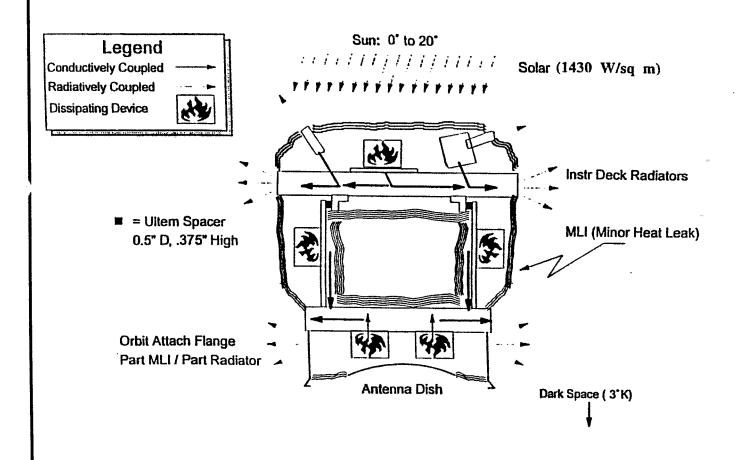

88898	A	7345-9012				
SCALE		DO NOT SCALE PRINT	SHEET	4-2		

The spacecraft will be thermally stable at the Earth-Sun libration point since there is very little variation in the thermal environment. The main cause of any thermal perturbations will be internal power fluctuations. However, customary thermal analysis techniques require that many of the thermal design parameters be allowed to vary between hot and cold cases to ensure that the design is robust. Therefore, for a spacecraft which is expected to be in a stable environment, the resultant predicted temperature variations and heater power requirements are primarily driven by the degree of variation in the thermal parameters.

Incident external environmental fluxes are included in Figure 4.2-1 for use by the instrument thermal engineers. The flux values are assumed to be averaged over the spin of the ACE spacecraft. At 5 rpm, transient effects are expected to be minimal.

# 4.2.1 Spacecraft-Instrument Interface Temperatures

The interface temperatures specified for the instruments and their components are always assumed to be on the spacecraft side of the interfaces. A protoflight design and test interface range is specified for each instrument depending on its type of mounting. The instrument must be capable of maintaining the temperature of all its components within the operational ranges given in the SIIS while the deck interface temperature is within the design/test range. The design/test interface temperature range is 5° C outside of the spacecraft operating range. In addition, a survival range is specified for each instrument interface. While the observatory is in survival mode, i.e., all instruments off and spacecraft in survival mode, each instrument must maintain the temperature of its components within the survival ranges given in the SIIS.

For cases in which one or more instruments are powered off while the spacecraft is still in operational mode, instrument interface temperatures will be maintained within operational limits by interface heaters located on the deck. Under these circumstances, the ACE Observatory is still defined as being in operational mode. For analysis, instruments should always use the spacecraft design/test temperature range of their interfaces.

The instruments should recognize the difference between the interface temperature ranges specified in Section 4.2.1 and the various temperature ranges specified in the SIIS. The interface temperatures should be used as inputs to the instrument thermal models. For an isolated instrument, the interface temperature should, by design, have little impact on its internal component temperatures. An instrument with a conductively coupled interface will have a greater dependence on interface temperature, but, only as a more significant input to its thermal model. The interface ranges are not specifically required to fall within any component range defined for an instrument. However, the definition of the interface temperature ranges for an instrument is consistent with the requirements of its responsible thermal engineer.

The spacecraft is responsible for the transition of interface temperatures from survival to operational mode. However, each instrument is responsible for transitioning its components from survival to turn-on, given that the interface temperatures shall be within the design/test range specified in this section. The simplest approach is for an instrument to define its minimum survival and turn-on temperatures to be the same, if possible.

Control of Observatory deck temperatures at the instrument mounting locations will depend on the choice of individual mounting configurations. Instrument sensors which require a

88898	A	DWG. NO. 7345-90	012	
SCALE		DO NOT SCALE PRINT	SHEET	4-3

thermally cond uctive interface with the deck can expect a design/test range of -15° C to +15° C and a survival range of -25° C to +15° C on the spacecraft side of the interface. These ranges are consistent with the instrument temperature requirements defined in each SIIS and should be used for instrument thermal analyses. Instrument sensors with thermally conductive interfaces have a direct effect on spacecraft thermal design. Therefore, the demands placed by the spacecraft on instruments with thermally conductive interfaces are more severe than for those instruments with isolated interfaces.

Instrument electronics boxes that require thermally conductive interfaces with the deck will be treated as general electronics unless,

a) The box cannot be thermally separated from its sensor; or,

b) The box has component limitations preventing exposure to the typical design range for general electronics.

General electronics boxes have a design/test temperature range of -23° C to +55° C at their mounting interfaces. The survival temperature range is also defined as -23° C to +55° C. Instrument electronics boxes which cannot be treated as general electronics must negotiate their interfaces with the spacecraft thermal engineer. Allowable temperature ranges shall be included in the appropriate SIIS.

Instruments which are isolated from the deck have only a minor effect on spacecraft thermal design and are less sensitive to the interface temperature. Interface temperatures for isolated instruments shall have a design/test range of -20° C to +40° C. The survival range shall be -25° C to +40° C on the spacecraft side of the interface. These ranges are consistent with the temperature requirements defined in the SIIS for each isolated instrument and should be used in the instrument thermal analyses.

Instruments mounted to the ACE side panels will be exposed to a design/test interface temperature range of -10° C to 40° C. During the Observatory survival mode, instrument interfaces on the side panel will be maintained within the same range of -10° C to +40° C. Instruments mounted to the aft deck will be exposed to an design/test interface temperature range of -10° C to +45° C. During the Observatory survival mode, instrument interfaces on the aft deck will be maintained at the same range of -10° C to +45° C. Specific instrument interface temperature information is found in Figure 4.2.1-1

## 4.3 <u>Instrument Sensor Thermal Design and Control</u>

The instrument/sensor experimenters shall be responsible for the thermal design of their instruments/sensors. The primary methods of thermal control available to the instrument/sensor designers are illustrated in Figure 4.3-1 and are described below. Figure 4.3-2 illustrates the specific instrument thermal control methods. The choice of thermal control method will be made by the spacecraft thermal engineer in conjunction with the instrument/sensor engineer. For all methods of thermal control, the instrument thermal engineer must take into account the allowable deck temperatures on the spacecraft side of the thermal interfaces.

a) Local Thermal Control: Thermal dissipation is radiated directly from the external instrument/sensor surfaces to space. All non-radiator surfaces must be radiatively isolated from the spacecraft and other instruments. In addition, the instrument must be conductively isolated from the spacecraft. The instrument thermal engineer must be able to show, by analysis, a thermal interface resistance of ≥20°C/W. Finally, the

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	4-4

Figure 4.2.1-1 ULEIS Interface Temperature Data

# Reference GIIS Paragraph 4.2.1


The ULEIS instrument requires a hybrid thermal control system as defined in Paragraph 4.3. The interface temperature ranges of the ULEIS components shall be as stated in Table 4.2.1-1

Table 4.2.1-1 ULEIS/Spacecraft Interface Temperatures

Operational Temp. Range	Survival Temp. Range
-20 to +40°C	-25 to +40°C
-15 to +15°C	-25 to +15°C
-23 to +55°C	-25 to +15°C
	-20 to +40°C -15 to +15°C

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9	012	
SCALE		DO NOT SCALE PRINT	SHEET	4-5

Figure 4.3-1 Typical Instrument/Sensor Thermal Control Methods

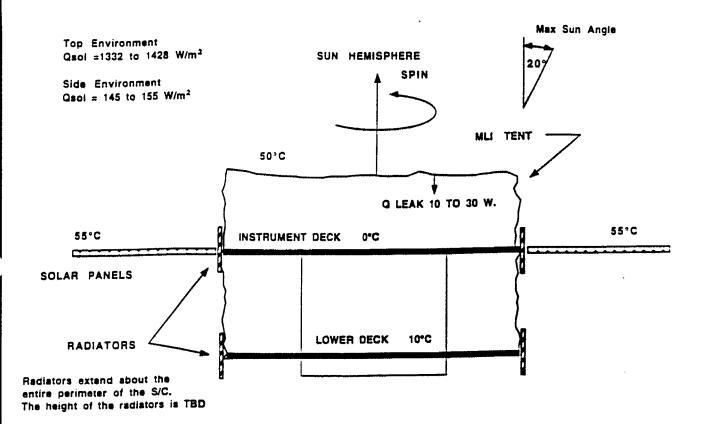

#### RADIATOR EFFECTIVENESS ( W/m2)

#### RADIATOR SIZE ( TBD )

S/C Temp.	Solar Array Sides	Open Sides		S	olar Array Sides	Open Sides
-20°c	108.8	150.9 221.2	S/C Power	216.4W. 117.4W.	7° 4°	8° 4°
+20°c	305.3	308.6				-


88898	A	DWG. NO. 734	<b>15-9012</b>	
SCALE		DO NOT SCALE PRINT	SHEET	4-6

Figure 4.3-2 ULEIS Thermal Control Method

## Reference GIIS Paragraph 4.3

The thermal control design for the ULEIS telescope is shown in the illustrations below. The ULEIS DPU and the ULEIS Analog Box are conductively mounted to the spacecraft deck through a Cotherm pad and the heat generated by these ULEIS components is conductively conducted to the spacecraft deck and then conducted to side panel radiators for rejection to space.

Note: The installation of the MLI blanket between the telescope and the +Z deck shall be the joint responsibility of both spacecraft and instrument engineers.

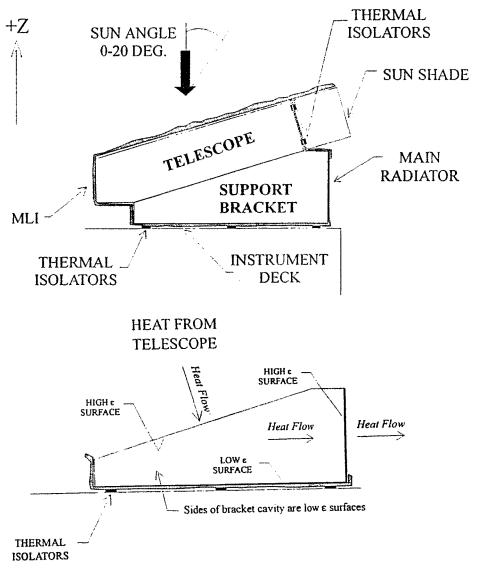

Γ	FSCM NO.	SIZE	DWG. NO.		
	88898	A	7345-	9012	
Ì	SCALE		DO NOT SCALE PRINT	SHEET	4-7

design placement of local radiators, if required to remove localized heat, must be coordinated with the spacecraft thermal engineer.

- b) Central Thermal Control: Thermal dissipation is conducted from the instrument/sensor to the observatory deck for eventual rejection to space. Candidates for central control include support electronics that have no apertures and which can be thermally decoupled from the sensor sections that require extended temperature ranges. Use of central thermal control requires approval of the spacecraft thermal engineer.
- c) Hybrid Thermal Control: Thermal dissipation is removed from the instrument/sensor via a combination of radiation to the environment and conduction to the observatory deck. The use of hybrid thermal control is undesirable because of analysis difficulties. Instruments desiring hybrid control must demonstrate the necessity of its use and be prepared to work very closely the spacecraft thermal engineer if its use is allowed.

In any case, the thermal design of the instruments/sensors will require cooperation between the instrument/sensor thermal engineer and the spacecraft engineer. It is important that liaison between instrument/sensor designers and the spacecraft designers begins as early in the design phase as possible.

# 4.4 PAYLOAD INSTRUMENT/SENSOR SPACE ENVIRONMENT TEMPERATURE LIMITS

The allowable instrument/sensor orbital temperature limits shall be established by the experimenter and documented in Figure 4.4-1. Instrument thermal models, delivered to the spacecraft, must include nodes for all critical temperatures defined in Figure 4.4-1. As a minimum, the following limits shall be specified at the appropriate control locations:

- a) Operating Limits: Temperature range within which each instrument/sensor must meet its operating specifications. For instruments utilizing Local Thermal Control, the operating limits must be specified at control surfaces, usually the radiators. Limits must also be given for critical components within the instrument and for acceptable deck interface temperatures. For instruments utilizing Central Thermal Control, operating limits must be specified at the spacecraft side of the interface between the instrument and the deck. Limits for critical components must also be specified. For instruments utilizing Hybrid Thermal Control, operating limits must be specified for all control locations and for critical components.
- b) Survival Limits: Widest temperature range that each instrument/sensor can undergo in an unpowered state without damage or performance degradation. Survival limits must be specified at the appropriate thermal control locations as defined above for Operating Limits.

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-	-9012	
SCALE		DO NOT SCALE PRINT	SHEET	4-8

Figure 4.4-1 ULEIS Temperature Limits

Reference GIIS Paragraph 4.4.

ULEIS Component	Operating (IN-SPEC) (°C)	Design/Test (°C)	Survival Power-Off (°C)	Turn-On
Analog Elect.	-15 to +15	-23 to +55	-23 to +60	-23 to +55
DPU	-15 to +50	-23 to +55	-23 to +55	-23 to +55
Telescope	-25 to 0	-30 to +30	-30 to +35	-30 to +30

FSCM NO.	SIZE	DWG, NO.				
88898	Α	7345-9012				
SCALE		DO NOT SCALE PRINT	SHEET	4-9		

Turn-on Limits: Widest temperature range within which each instrument/sensor must be capable of turning on without damage or performance degradation of any kind. The instrument is-not necessarily required to operate within design specifications at the turn-on limits. However, once the instrument is within the specified operating limits, full compliance with design specifications is required. In most cases, the turn-on temperature range should be the same as the survival temperature range.

#### 4.5 OBSERVATORY TEST TEMPERATURE LIMITS

Observatory thermal and thermal vacuum test limits are documented in APL 7347-9007. The instruments/sensors shall survive and not suffer damage or performance degradation after exposure to the specified limits. In general, temperature variations at the interfaces of the instruments are given by the design/test limits. Under no circumstances shall the temperature on the spacecraft side of the interface be allowed to exceed the corresponding instrument interface design/test limits defined here and in section 4.2.1

#### 4.6 TEMPERATURE SENSOR LOCATIONS

The spacecraft integration team will mount temperature sensors to the baseplate of each instrument/sensor in order to monitor the interface temperature. The temperature sensors will be provided and located by the spacecraft designers. The location of each temperature sensor shall be depicted on the instrument/sensor interface control drawing and documented in Figure 4.6-1.

## 4.7 PAYLOAD INSTRUMENT/SENSOR THERMAL MODEL ANALYSIS

#### 4.7.1 Thermal Model

A reduced thermal model of each instrument/sensor shall be provided by the instrument/sensor thermal engineer for inclusion in the overall spacecraft thermal model. The number of nodes in each model shall be consistent with the thermal complexity. Simple systems may have as few as three nodes. The models should include nodes for all critical components. Thermal models shall be provided in the SINDA format.

After integration with the spacecraft thermal model, the reduced instrument thermal models will be used by the spacecraft thermal engineer to predict instrument temperatures. Therefore, the reduced models should correlate well with the detailed instrument thermal model in the areas of heat transfer across the spacecraft interface, heat transfer with the space environment, and critical component temperatures. In addition, detailed instrument thermal models must be validated during some phase of thermal vacuum testing. If the instrument sponsors do not require qualification testing in vacuum, then, the interfaces cannot be validated until the observatory level thermal vacuum test. At that point, each instrument risks the possibility that its interface will differ significantly from that of the thermal model. Since the instrument models will be relied upon to define thermal control requirements of the instrument deck and surrounding surfaces, a significant error in the models could limit the thermal control available during flight. Specific instrument thermal model information is defined in Figure 4.7.1-1.

FSCM NO.	SIZE	DWG. NO.			
88898	Α	7345-90	012		
SCALE		DO NOT SCALE PRINT	SHEET	4-10	

Figure 4.6-1 Location of Spacecraft Supplied Temperature Sensors

Not Applicable to the ULEIS instrument.

FSCM NO.	SIZE	DWG, NO.			
88898	Α	7345-9012			
SCALE		DO NOT SCALE PRINT		SHEET	411

Figure 4.7.1-1 ULEIS Thermal Model Information

Instruments or instrument components which generate heat and are conductively coupled to the spacecraft shall be modeled as diffusion nodes having variable heat sources within the limits defined in Table 4.7.1-1. The node numbers for ULEIS shall be from 900 to 999 inclusively. Thermal models shall be delivered directly to the SDT by the IDT. Thermal models are not included in this document.

Component	Nominal (W)	Peak (W)
Analog Electronics	5.5	6.3
DPU	2.86	3
Telescope	2.14	2.36
TOTAL	10.50	11.66

FSCM NO.	SIZE	DWG. NO.		
88898	Α	7345-9	0012	
SCALE		DO NOT SCALE PRINT	SHEET	4-12

## 4.7.2 Geometry Model

Experimenters shall provide, to the spacecraft, geometric models of their instruments in SSPTA format, for inclusion in the overall spacecraft geometric model. In return, the spacecraft will -provide flux information for each surface of the model to the instrument/sensor designers for use in their detailed thermal modeling effort.

Geometric models shall be delivered to the spacecraft no later than June 7, 1993 to allow adequate time for incorporation into the spacecraft models prior to PDR. Updated models shall be delivered to the spacecraft no later than March 1, 1994 to allow adequate time for analysis prior to the spacecraft CDR.

## 4.8 THERMAL CONTROL DEVICES

Special thermal control devices required by an instrument shall be defined and described in the SIIS. The primary concern is for devices that will have some affect on the thermal interface between an instrument and the spacecraft.

## 4.8.1 Heaters

There are three classes of heaters that are of concern to the instruments/sensors aboard the ACE Observatory: interface, operational, and survival The instrument heater capacities are the peak power requirements for the operational, interface, and survival heaters shown in Figure 4.8.1-1

Interface heaters are mounted on the ACE experiment deck and are used to augment the instrument deck operational heaters during times when one or more instruments are turned off. The interface heaters replace some of the dissipation lost when an instrument is turned off. Sizing and placement of the interface heaters is the responsibility of the spacecraft thermal engineer. The heater power is allocated from the spacecraft power budget.

The interface heater design effort cannot be completed until all of the final instrument thermal models have been incorporated into the spacecraft thermal model. The interface heaters are of primary importance to the instruments that utilize central thermal control. Instruments utilizing local thermal control are less affected by changes in deck temperature because of low thermal conduction in the interface.


The two remaining types of heaters, operational and survival, fall within the domain of the instrument thermal engineer. The instrument operational heaters are intended to support internal temperature requirements and can be used during normal instrument operation. The use of operational heaters is optional and the heater power will be allocated from the instrument power budget. Since the majority of the instruments are baselining a thermally isolated design, it may be necessary for the spacecraft to provide some additional instrument operational heater power. This will only be possible if the spacecraft deck temperature limits are as indicated in Section 4.2.1.

The ability of the spacecraft thermal engineer to provide additional operational heater power to the instruments will depend on the outcome of the overall spacecraft thermal analysis which will include all of the instrument thermal models. If additional operational heater power is required, the instrument thermal engineer must work with the spacecraft thermal engineer to define the requirement.

88898	A	DWG. NO.	345-9012		
SCALE		DO NOT SCALE PRINT		SHEET	4-13

Figure 4.8.1-1 ULEIS Thermal Control Devices

Thermal control of the ULEIS DPU and Analog Electronics Box is maintained by control of the interface temperature located at the footprint of the components on the observatory forward deck forward face. The ULEIS Telescope employs an operational heater, a survival heater and an interface heater which is located under the telescope bracket. A schematic of the ULEIS thermal control devices is shown below.

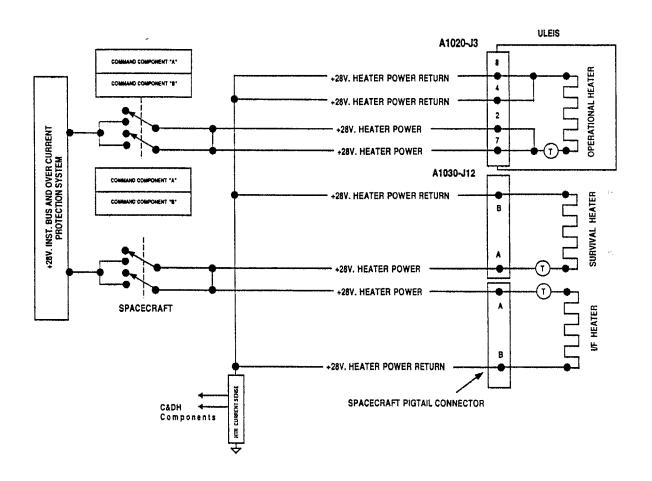

88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	4-14

Additional operational heater power will only be provided if the instrument thermal engineer-can show that no other reasonable means can be used to control the instrument within its operational limits. This heater power is not for use in place of operational heaters already defined in the instrument design. Finally, if the final instrument analysis shows that the additional heater power will not be used, it will be reallocated to the spacecraft heater power budget.

The instrument survival heaters support internal temperatures during periods in which the instrument is in a powered off state. However, when an instrument is off, its operational power will be reallocated to the spacecraft power budget, specifically for the observatory deck interface heaters. Since only part of the instrument power budget will be used for interface heaters, there will be power available for instrument survival heaters. However, the instrument thermal engineer must coordinate the use of internal survival heaters with the spacecraft thermal engineer. Instrument survival heater power will be charged against the spacecraft power budget but cannot exceed the instrument operational power budget less the amount reserved for interface heaters.

FSCM NO. 88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	4-15

### 5.0 <u>PAYLOAD INSTRUMENT/SENSOR MAGNETIC INTERFACE</u> REQUIREMENTS

The ACE Observatory includes a sensitive magnetometer. Residual magnetic fields from the payload instrument/sensors and the spacecraft subsystems must be kept to a minimum by using standard magnetic cleanliness guidelines which include: minimum use of magnetic materials, power feed and return line twisting, compensation techniques, grounding, battery placement and solar panels with back wiring and other magnetic field reduction techniques.

There is a goal of achieving an Observatory residual magnetic field, at the Magnetometer sensor(s) position, which is less than 0.1 nT. The goal for AC interference, at the Magnetometer sensor(s) location, is less than 0.001 nT over a frequency range of 0 to 10 Hz and the specific frequencies of 15 kHz (±200Hz), 30 kHz (±200 Hz) and 60 kHz (±200 Hz). Guidelines for reducing magnetic fields are given in the Environmental

Guidelines for reducing magnetic fields are given in the Environmental Specification, 7345-9007.

## 5.1 INSTRUMENT/SENSOR DEGAUSSING

Currently, there are no plans to degauss hardware at JHU/APL prior to integration with the spacecraft.

#### 5.2 INSTRUMENT MAGNETIC FIELDS

Any instrument/sensor which generates a magnetic field shall specify the level and nature of the field in Figure 5.2-1.

FSCM NO.	A	DWG, NO.	7345-90	012	· · · · · · · · · · · · · · · · · · ·
SCALE		DO NOT SCAL	E PRINT	SHEET	5-1

# Figure 5.2-1 ULEIS Magnetic Field Properties

The ULEIS instrument is being designed with a minimum of magnetic material. However, a permanent magnet stepper motor will be used for the Iris Mechanism. The magnetic characteristics of this motor have been measured by the Magnetometer team.

FSCM NO.	A	DWG. NO. 7345-9	012	
SCALE		DO NOT SCALE PRINT	SHEET	5-2

- 6.0 <u>PAYLOAD INSTRUMENT/SENSOR ELECTROMAGNETIC</u> <u>INTERFACE REQUIREMENTS</u>
- 6.1 PROGRAM REQUIREMENTS
- 6.1.1 Objectives

All electronic components of the ACE Observatory must operate in electromagnetic harmony. The object of the Observatory EMI/EMC program is to verify compatibility of the payload sensors with each other, the spacecraft subsystems, and the launch site environment.

The Observatory shall conform to MIL-STD-461B, Part 3, Class A2a, tailored for the ACE mission. The specific requirements are given in the ACE Environmental Specification APL 7345-9007. The Observatory shall be tested in accordance with MIL-STD-462, tailored to the ACE mission.

FSCM NO.	SIZE	DWG, NO.				
88898	Α	7345-9012				
SCALE	DO NOT SCALE PRINT		SHEET	6-1		

## 7.0 ENVIRONMENTAL INTERFACE REQUIREMENTS

The environments that the instruments/sensors will be exposed during all phases of the ACE mission, including ground handling, storage, integration, testing, transportation, launch and flight operations are described in the ACE Environment Definition, spacecraft and Observatory Test Requirements and Instrument Test Recommendations Document, APL 7345-9007. Any deviation from the guidelines in aforementioned specification shall be presented in detail in Figure 7.0-1. Instruments shall be designed to withstand electrostatic discharge (ESD) possible during packing and unpacking, transportation, and integration.

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	7-1

Figure 7.0-1 Deviations from ACE Environments and Test Requirements Specification

ULEIS will conform to the ACE Payload Environmental Design and Test Requirements: ACE-CT-100-22

FSCM NO.	SIZE	DWG. NO.	· · · · · · · · · · · · · · · · · · ·		
88898	Α	7345-9012			
SCALE		DO NOT SCALE PRINT		SHEET	7-2

#### 8.0 PAYLOAD INSTRUMENT/SENSOR CONTAMINATION CONTROL

#### 8.1 GENERAL

The contamination requirements for each of the payload instruments/sensors shall be documented in Figure 8.1-1. Prior to integration, the instrument/sensor experimenters shall verify the cleanliness levels of all sensitive surfaces. The test methods shall be identified by the experimenter.

The following chemicals are prohibited in the integration and Observatory test areas:

- a) Aromatic Hydrocarbons
- b) Acetone
- c) Methyl Ethyl Ketone
- d) Propyl Alcohol
- e) Xylene
- f) Acetylene
- g) Vacuum pump oil and oil vapor
- h) Ammonia
- i) Caustic or acid fumes
- j) Mercury
- k) Ionic Salts
- 1) TBD.

#### 8.2 PURGING

If required, instruments/sensors will be provided, throughout the integration and test phases at JHU/APL and the launch site, a nearly continuous flow of dry filtered nitrogen distributed through Teflon FEP tubes. Purge will be interrupted during thermal-vacuum testing and certain ground handling procedures. Instrument/sensor test teams will be notified in advance of interruptions lasting longer than the times specified in the Specific Instrument Interface Specification. Purge shall be provided until the observatory is disconnected from the umbilical at lift-off. The instrument/sensor designer is responsible for the design of the purge system within their instrument/sensor.

#### **8.2.1 Purge Connectors**

Instruments/sensors, which require continuous purging from the spacecraft purge manifold, shall use the following purge fitting: SWAGELOCK SS-400-X-X.

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	8-1

Figure 8.1-1 ULEIS Contamination Requirements

The ULEIS instrument has no special contamination requirements other than the normal precautions taken in the handling of delicate, static sensitive flight hardware. Ethyl alcohol is the only cleaning agent approved for use in the vicinity of ULEIS.

88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	8-2

## 8.2.2 Purge Gas Flow Rate

Determination of the purge gas flow rate shall be the responsibility of the instrument/sensor experimenter. The necessary purge gas flow rate shall be controlled by the use of a restrictor integral with the purge connector or contained within the instrument/sensor. **Purge gas flow rate and restrictor information shall be documented in Figure 8.2.2-1.** The S/C purge manifold will be regulated at 3 psi. The maximum gas pressure is limited to 5 psi.

### 8.2.3 Materials Outgassing

Polymeric materials used in the instrument/sensor design shall conform to the requirements of the ACE Performance Assurance Implementation Requirements. **Exceptions and additions to these outgassing requirements shall be documented in Figure 8.2.3-1.** 

FSCM NO.	SIZE	DWG. NO.	, , , , , , , , , , , , , , , , , , ,	
88898	A	7345-9	012	
SCALE		DO NOT SCALE PRINT SHEET		8-3

# Figure 8.2.2-1 ULEIS Purge Requirements

ULEIS requires continuous purge until umbilical separation.

THE OWN AT	PURITY	TEMP.	TIME	REMARKS
INST. GAS FLOW RATE			II-vil ambiliant congration	Pressure: < 5psi
ULEIS NITROGEN 1.0 l/m	Prefer liquid boil-off	>dewpoint,<30°c	Until umbilical separation	Tressure oper

88898	A	DWG. NO. 7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	8-4

Figure 8.2.3-1 Exceptions or Additions to General Outgassing Requirements

ULEIS takes no exceptions.

FSCM NO.	SIZE	DWG. NO.		_
88898	Α	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	8-5

			•	, .
			ok	

## 9.0 PAYLOAD INSTRUMENT/SENSOR GROUND SUPPORT EQUIPMENT

#### 9.1 GENERAL

Ground support equipment (GSE) used for integration testing and prelaunch operations is the experimenter's responsibility and shall demonstrate compliance with the provisions of this document including contamination control, ground handling and storage.

The instrument/sensor GSE shall be capable of:

- a) verifying that the instrument/sensor has survived shipment and is ready for integration.
- b) accepting and processing the Observatory telemetry and science data downlink in real time and performing engineering analysis necessary to verify the successful operation of the instrument during all levels of Observatory testing.
- c) provide any required external stimulus.

### 9.2 INTERFACE

All GSE interfaces between the instrument/sensor and the ACE Observatory shall be documented in Figure 9.2-1. The GSE shall not interface directly with any spacecraft subsystem. Any GSE interface with the instrument shall be buffered and not have any impact on the S/C interfaces.

#### 9.2.1 <u>Telemetry Interface</u>

The ACE Observatory GSE Interface and Test Operation Control Center (ITOCC) will provide the full S/C telemetry stream to each Payload GSE.

### 9.2.2 Command Interface

The ACE Observatory GSE (ITOCC) will provide serial interfaces for inputs from instrument GSEs to synchronize instrument/sensor testing with the instrument/sensor stimulus configuration.

#### 9.2.3 Sun Sensor Interface

The ACE Observatory will provide buffered outputs of the Sun Pulse and the Spin Clock for instrument/sensor GSE synchronization.

#### 9.3 GENERAL DESIGN FEATURES

The design and material construction of the GSE should incorporate the following features:

FS	SCM NO.	SIZE	DWG. NO.		
	88898	Α	7345-9012		
sc	CALE	DO NOT SCALE PRINT		SHEET	9-1

# Figure 9.2-1 ULEIS GSE Interface

Institutional

BCE required for DPU testing - APL DPU I/F simulator for UMD

Test Equipment for Board-level tests - UMD

**BCE** for testing Telescope

BCE req'd for analog electronics testing including pulsers to be used during


instrument level testing

Test Pulse Generator for S/C testing

System Level

- APL responsibility

- Main GSE computer with S/W and I/O cards
- Instrument power supply with protection
- S/C simulator
- Sensor stimulus modules (from UMD)

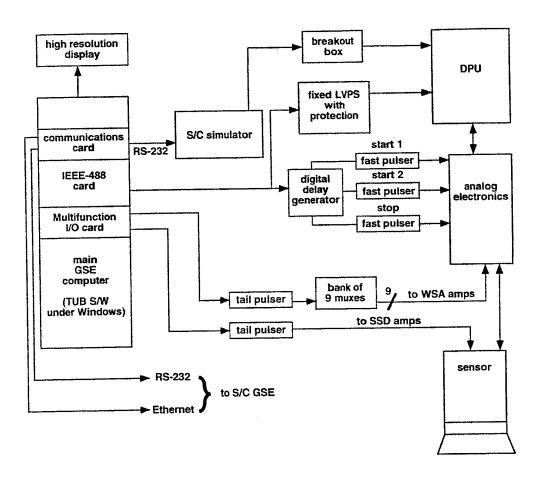

88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	9-2

- a) EMC Shielding
- b) Low Contamination Potential
- c) Easily Transportable (if necessary, provide I-bolts for the overhead crane)
- d) Ability to Test Instrument/Sensor on the Bench and After Observatory Integration.

#### **9.3.1** Power

The instrument GSE shall not draw power from the spacecraft power systems; nor shall it provide power to the S/C unless the designer has first obtained written approval from the JHU/APL Program Office. Instrument/Sensor providers shall provide information on power requirements prior to delivery to the integration facility.

## 9.3.2 <u>Identification and Marking</u>

GSE equipment shall be clearly marked with the following information:

- a) Name of Assembly.
- b) Part number.
- c) Serial number.
- d) Manufacturer.
- e) Power requirements.
- f) Instrument name.

#### 9.3.3 Calibration

The calibration of the GSE shall be the responsibility of the payload instrument/sensor experimenter. Spares, consumables and field replaceable critical components shall be defined and documented in the SIIS.

#### 9.3.4 Documentation

The instrument/sensor GSE is the only equipment which is able to analyze the unique instrument/sensor data and operation characteristics. The GSE must therefore be included in the Observatory test and calibration procedures. The provider shall supply the following documentation for Observatory level testing:

- a) Specifications
- b) Set-up Procedures
- c) Safety Requirements, Operation Limits and Constraints

#### 9.3.5 Radioactive Sources

Radioactive sources required during integrated system tests, thermal vacuum tests and pre-integration acceptance tests shall be provided by the instrument/sensor providers and shall conform to all relevant U.S. Government, State of Maryland, and JHU/APL procedures for possession and use.

ſ	FSCM NO.	SIZE	DWG. NO.			
	88898	A	7345-9012			
	SCALE		DO NOT SCALE PRINT	SHEET	9-3	

Each instrument radioactive source shall be identified by isotope name, activity, emitted particles and energy and shall be documented in Figure 9.3.5-1.

# 9.3.6 Thermal Vacuum Testing

Any non-flight hardware required inside the TV Chamber to support TV tests shall be approved by the spacecraft Integration and Test Engineer and shall meet the outgassing requirements of this document.

88898	A	DWG. NO. 7345-	9012	
SCALE		DO NOT SCALE PRINT	SHEET	9-4


Figure 9.3.5-1 ULEIS Radioactive Source List

Note: All Federal and state licenses pertaining to the use of radioactive sources are the responsibility of the IDT.

Source	Quanity
Gadolinium	0.1 microcurie
Curium 244	1 microcurie

Access to radioactive sources will be required during Integration and Test. The radioactive sources are installed permanently on the closable cover on the telescope.

88898	A	DWG. NO. 7345-90	12	
SCALE		DO NOT SCALE PRINT	SHEET	9-5

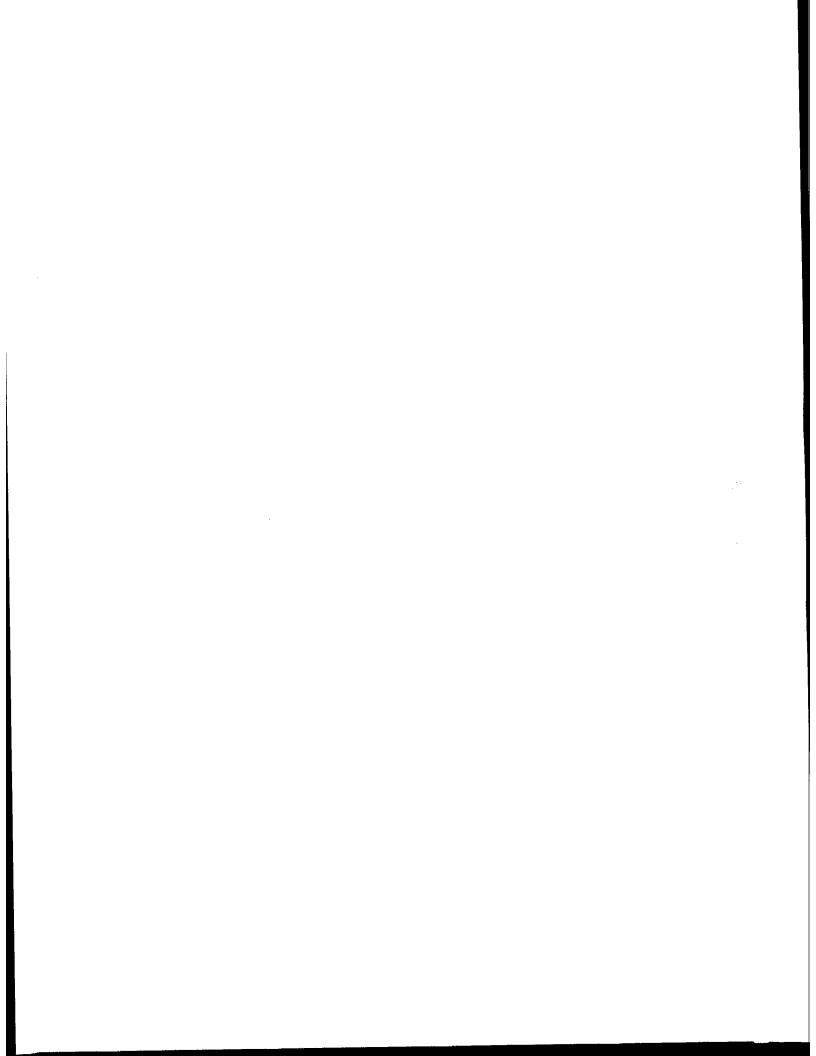

## 10.0 SPACECRAFT CABLE RESPONSIBILITIES

#### 10.1 GENERAL POLICY

below:

Consistent with past programs, the spacecraft does NOT provide any intrainstrument cabling (between instrument components) as part of the spacecraft harness responsibility. For instruments with more than one component, the spacecraft will be responsible for positioning these components and for routing any cabling between the components. The Instrument/Sensor experimenters shall provide all connecting cabling within their instrument subsystem.

### 10.2 INSTRUMENT CONCERN ON INTRA-INSTRUMENT CABLING

Several instruments will have more than one component within their instrument subsystem. This particularly applies to the instruments being served by an external DPU, with the DPU functioning as one of the "components" for several instrument subsystems. Meanwhile, the deck layout will be governed by many constraints, including FOV, magnetics, center of gravity, and so on, which could force the "components" of an instrument subsystem to be nonadjacent. In addition, minor changes in positioning may be needed late in the program to accommodate things such as refinement of component mass and cg, etc., as they are received. The spacecraft is responsible for routing the cabling between instrument components when they are distributed. This routing determines the cable length which the instruments would then have to provide. Several of the instruments expressed concern over providing cables between their instrument components in this type of scenario. A request has been made for the spacecraft to provide certain flight intra-instrument cables as part of the spacecraft harness. This request is reasonable, and the spacecraft will satisfy this request, under the stated conditions below. The spacecraft also has concerns regarding this new interface, but with properly handled agreements as described below, all parties should be satisfied.

## 10.3 CONDITIONS FOR GENERAL POLICY EXCEPTIONS

The spacecraft can only provide flight cables under certain conditions as listed

- a) The spacecraft cannot provide any performance sensitive cables; these cables must be provided by the instrument/sensor experimenter. **Constraints** for their use shall be documented in Figure 10.3-1.
- b) The spacecraft will only fabricate cables for the flight harness, i.e. cables will not be provided for instrument/sensor level testing.
- The instrument/sensor experimenter must provide the connectors used for flight cable fabrication. This procedure will ensure the correct mating connector. Mating connectors are easily procured at the same time that the instrument connector is procured. Three additional sets of connectors, plug, jack, and backshells, shall be provided for harness spares and for the breakout box used to test the harness.

FSCM NO.	SIZE	DWG. NO.		
88898	A	7345-9012		
SCALE		DO NOT SCALE PRINT	SHEET	10-1

Figure 10.3-1 Instrument Supplied Cable Constraints

Figure does not apply to the ULEIS instrument.

 FSCM NO.
 SIZE
 DWG. NO.

 88898
 A
 7345-9012

 SCALE
 DO NOT SCALE PRINT
 SHEET
 10-2

## 10.4 PROCEDURES FOR INTRA INSTRUMENT CABLING REQUESTS

A "Cabling Form" will be developed for each intra instrument flight cable to be fabricated by the spacecraft. This form will be separate from the SIISs, but will be handled by the APL ACE interface manager. This form will have two versions, first a "request" to let the spacecraft know that this cable is to be fabricated by the spacecraft. General information, as available at the time, should be included on this form, and should be submitted as soon as possible. Information to be provided on this "request" should include instrument identification, instrument components involved, cable type, cable length constraints (as available), connector type to be supplied (as available) and any other needed information. This form must then be followed much later by a "fabrication order" which must include the detailed information needed to fabricate the cable. The connectors should accompany this form. It is preferred that this information be in the form of a formal drawing; however, handwritten or hand drawn sketches will be accepted. Whatever form the final drawing takes, it must have the instrument representative's approval signature. Status of intra instrument cabling request and form/s is shown in Figure 10.4-1

After the cable is fabricated, it will be tested for continuity at APL to verify its compliance with the drawing. The drawing and cable will be verified with the instrument team when the instrument is delivered for Observatory integration.

88898	A	DWG. NO. 7345-	-9012		
SCALE		DO NOT SCALE PRINT		SHEET	10-3

Figure 10.4-1 Status of ULEIS Intra Instrument Cabling Request and Form/s

ULEIS will not require cabling support from spacecraft personnel.

 FSCM NO.
 SIZE
 DWG. NO.

 88898
 A
 7345-9012

 SCALE
 DO NOT SCALE PRINT
 SHEET
 10-4

#### 11.0 INSTRUMENT/SENSOR INTEGRATION

#### 11.1 DELIVERY

Each instrument/sensor supplier shall be responsible for the delivery of their instrument/sensor, its ground support equipment (), and the preship review documentation. The instrument/sensors and their associated equipment are delivered to JHU/APL as Government Furnished Equipment (GFE). Calibration of the is the responsibility of the instrument/sensor designer.

At JHU/APL, the instrument/sensor supplier shall be responsible for all testing prior to integration with the ACE Observatory.

JHU/APL will work with the instrument/sensor suppliers to develop integration and test plans. Instrument/Sensor suppliers will be responsible for providing Observatory level test sequences and pass/fail criterion. JHU/APL will use these data to prepare integration test plans and procedures.

## 11.2 INSTRUMENT/SENSOR RECEIVING/ACCEPTANCE AT JHU/APL

Each instrument/sensor shall be tested on delivery to JHU/APL. The following criteria will be used by JHU/APL for instrument/sensor acceptance.

- a) Prepare JHU/APL receiving flow card (SOR).
- b) Inspection for physical damage; document on flow card.
- c) Inspection for conformance with Interface Control Drawings; document on flow card.
- d) Record data package including handling procedures, test procedures and data; document on flow card.
- e) Instrument/sensor experimenters will perform post-shipment electrical tests to verify survival after shipment and confirm conformance to the performance specifications.
- f) JHU/APL integration and test engineers will review the instrument/sensor supplier's acceptance test data package for comparison with the data from the post-shipment electrical tests.
- g)\* JHU/APL PA Manager will review the instrument/sensor documentation to ensure closure of Problem Failure Reports and acceptance test discrepancies. This review is necessary to limit the risk to other flight hardware.
- h) JHU/APL integration and test engineers will review cleanliness documentation and handling procedures.

FSCM NO.		SIZE	DWG. NO.				
8889	98	A	734	45-9012			
SCALE		-	DO NOT SCALE PRINT		SHEET	11-1	

- i)\* The experimenter must provide test data or verification that the instrument/sensor will survive the test environments specified in the ACE environmental specification; APL 7345-9007.
- j) Acceptance shall be documented on flow card by the system engineer, integration and test engineer and the PA Manager.
- \* Data may be supplied at the Pre-Ship Review.

## 11.3 PRE-INTEGRATION INSTRUMENT/SENSOR INTERFACE TESTING

The purpose of the pre-interface test is to verify that instrument/sensor-to-spacecraft interfaces are within specifications before the instrument/sensor is integrated with the Observatory. Of particular interest are power turn-on transients. The instrument command telemetry interfaces shall be exercised during this test to verify correct performance. These test will be performed prior to integration. Mechanical fit checks will also be performed.

## 11.4 COMPREHENSIVE PERFORMANCE TEST

The purpose of the comprehensive performance test is to exercise as many instrument operational modes as possible in order to verify the proper performance of the instrument/sensor prior to integration with the Observatory. The integration of the with the instruments and performance verification is the responsibility of the experimenter.

## 11.4.1 <u>Comprehensive Performance Test Deliverables</u>

The instrument/sensor provider shall provide the following instrument test deliverables prior to integration:


- a) An overall instrument/sensor test plan.
- b) Detailed test procedures.
- A document containing specifications, charts, graphs, indicating expected test results. This will be used to compare with the actual test results for performance verification.


These test deliverables are part of the CALTECH IDDPs.

SCALE		DO NOT SCALE	E PRINT	SHEET	11-2
88898	Α	7345-9012			
FSCM NO.	SIZE	DWG, NO.			


**APPENDIX A -- ULEIS Instrument Mechanical Interface Drawings** 

## DO NOT SCALE PRINT SHEET A1

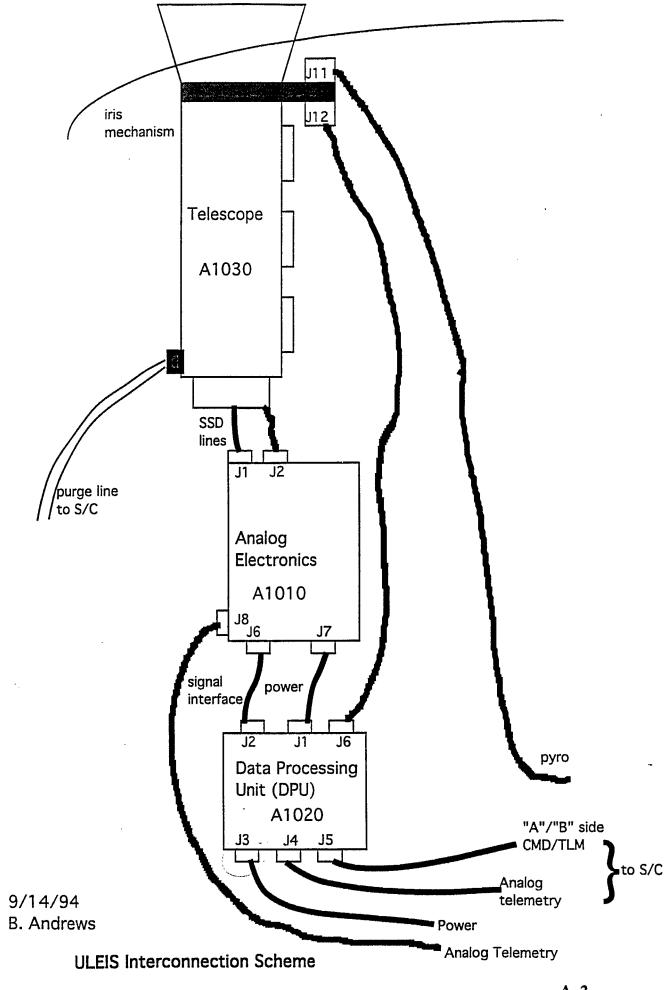


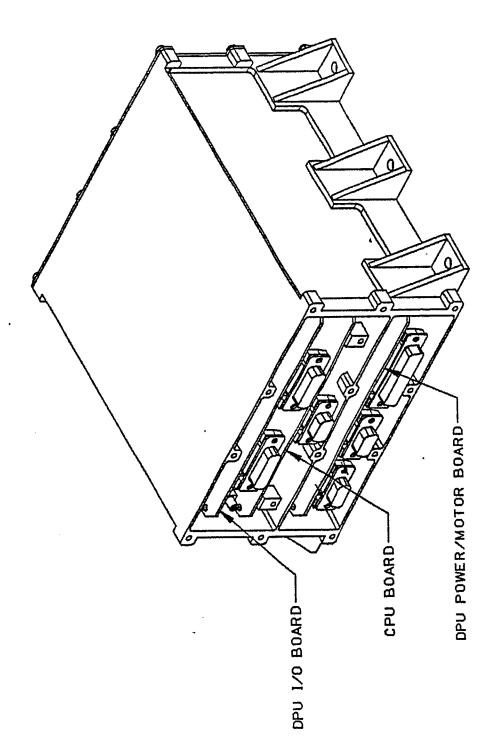

FRONT VIEW WITH COVER REHOVED

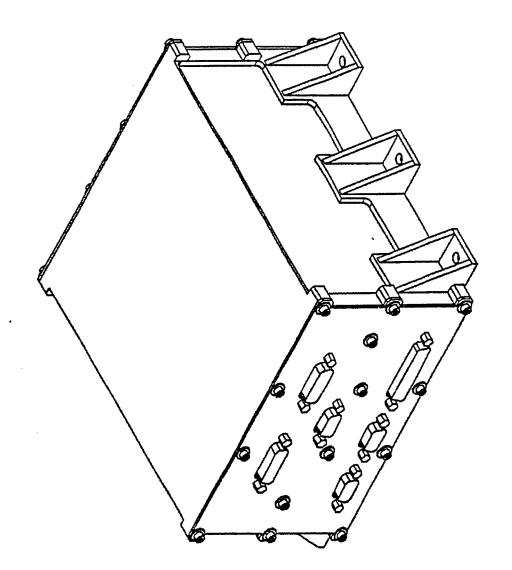

FRONT VIEW

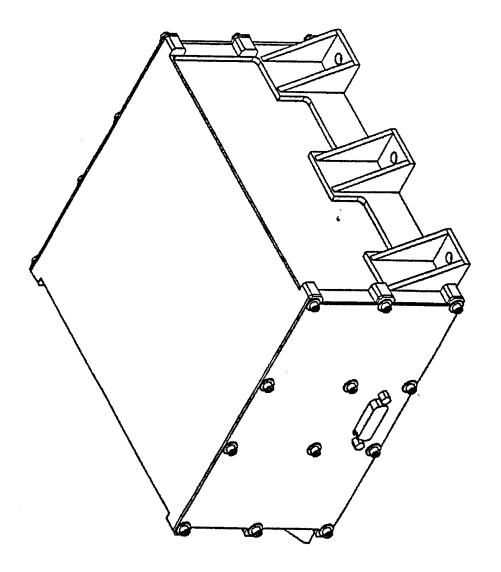

REAR VIEW